



## VW T6 - fuel loss

### Data sheet

Manufacturer	Volkswagen
Vehicle model	Transporter T6
Engine	2.0 TDI
Symptoms	Fuel loss

### Important safety note

## Vehicle smells of diesel - fuel loss

On the vehicle mentioned above, it can happen that a strong smell of diesel suddenly becomes very noticeable. Leaking fuel may also have accumulated in the engine compartment or under the vehicle. The cause of this is not always immediately recognisable. Firstly, the fuel lines and their connections in the engine compartment should be checked. If no leak is found, the fuel filter housing may be the cause of the diesel loss.

The fuel filter should be removed for further inspection. It is advisable to remove the cooling system's expansion tank beforehand. In order to be able to pull the filter upwards out of its support or holder, the clamping screw on such a holder must first be loosened. Then disconnect the two fuel lines from the filter.

If you now take a look at the upper area of the filter, in some cases a horizontal hairline crack can be seen, which is responsible for the leak.

In order to remedy the situation, the filter should be replaced and the fuel system bled in accordance with the vehicle manufacturer's instructions. We recommend cleaning the engine compartment as a final step of the repair.

## **IMPORTANT**

Please always follow the repair instructions from the vehicle manufacturer when carrying out such work!




Fuel loss T6





Expansion tank T6

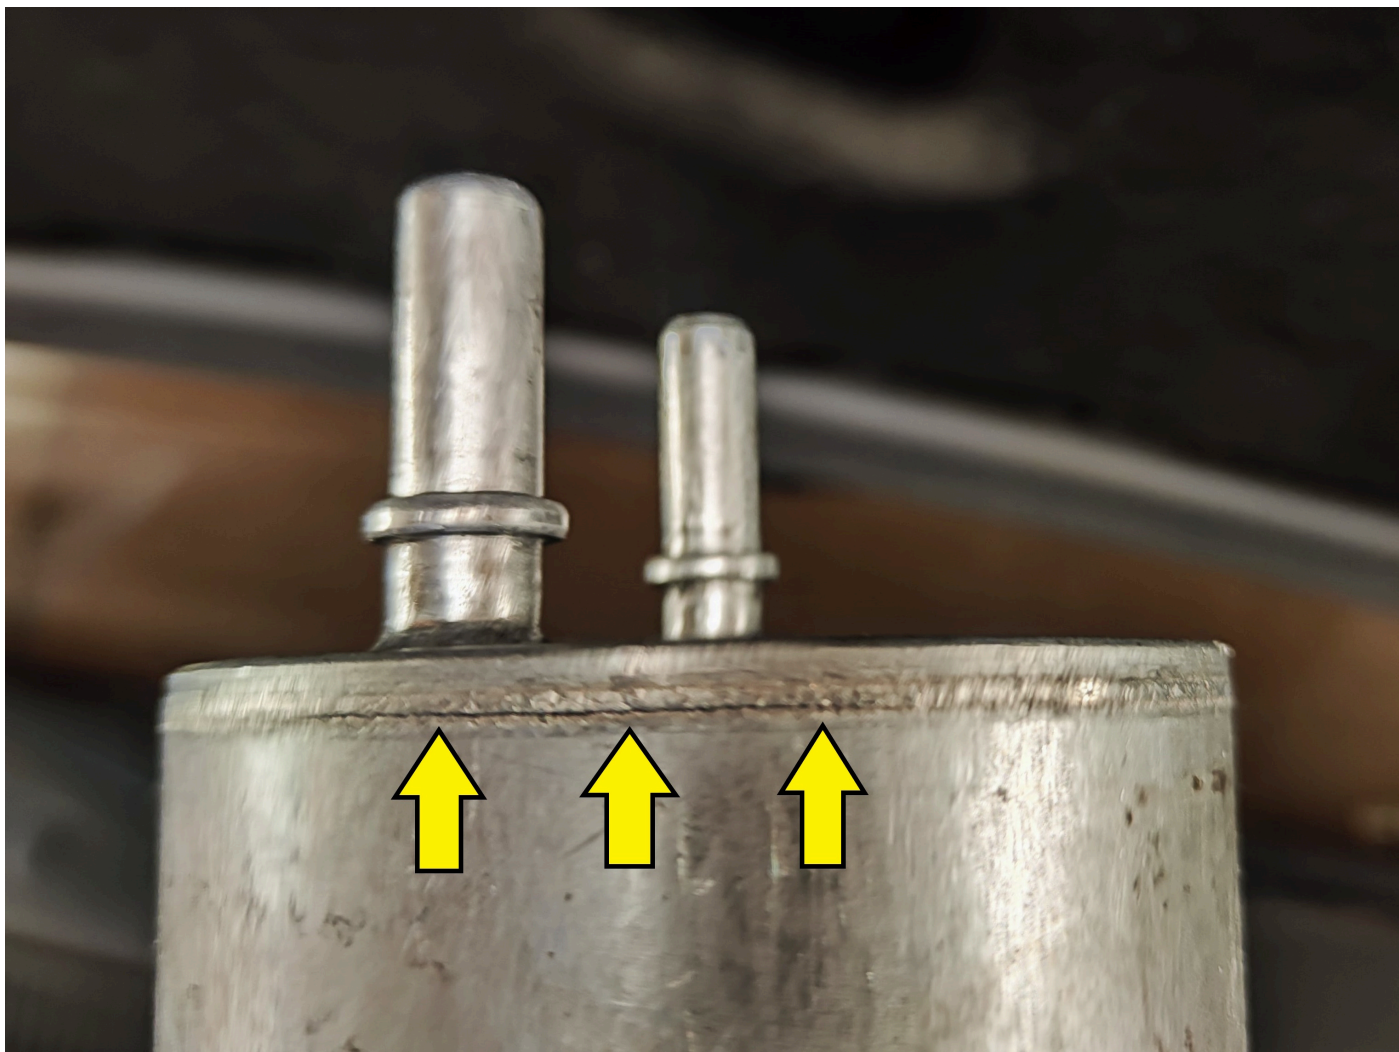

Fuel filter T6

## **This may also be of interest to you**

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.