

OPEL Zafira B - Le détecteur de l'angle de direction ne se laisse pas calibrer | HELLA

OPEL

Zafira B , CDTI

Moteur : Z19 DTH

Année modèle : à partir de 2005

Le détecteur de l'angle de direction ne se laisse pas calibrer.

Si un calibrage du détecteur de l'angle de direction avec l'appareil de diagnostic ne fonctionne pas après exécution de l'action sur le véhicule mentionné ci-dessus, la procédure suivante peut permettre de résoudre le problème.

- Débrancher la batterie
- Attendre 5 minutes
- Déposer le volant
- Orienter le détecteur de l'angle de direction (position centrale)
- Reposer le volant
- Rebrancher la batterie

Ensuite, renouveler le calibrage au moyen de l'appareil de diagnostic.

Veuillez prendre en compte dans ce contexte les instructions de montage ainsi que les dispositions de sécurité relatives à la manipulation des systèmes d'airbags du constructeur.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.