

Fiat Scudo - Potência insuficiente do ar condicionado | HELLA


Fiat

Scudo 1,6D Multijet 90

Ano de fabrico: de 2007 até VIN 84160387

Se nos veículos supracitados for detetada uma potência insuficiente do ar condicionado ou uma perda do líquido refrigerante, uma possível causa pode ser uma fuga na tubagem do líquido refrigerante entre o condensador e o compressor.

Verificar se a conexão do líquido refrigerante é do tipo correto e eventualmente substituir. (Ver figuras)

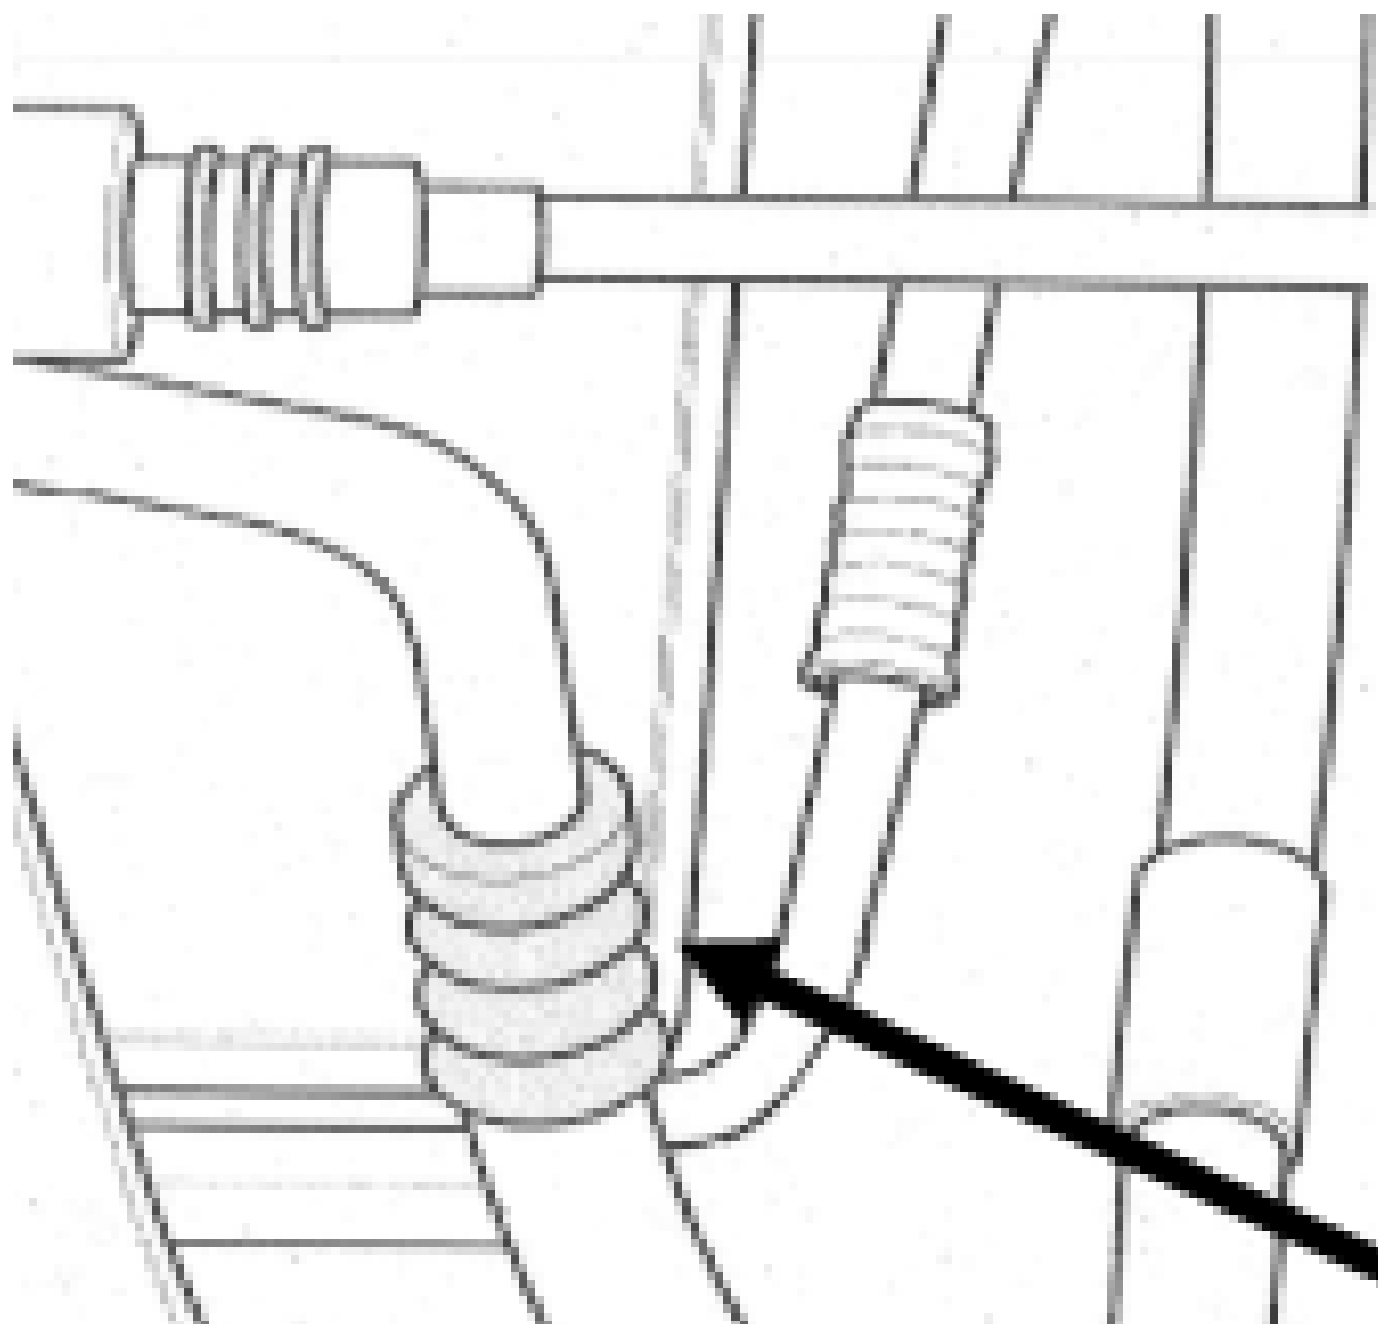



Tipo antigo

O fabricante automóvel dispõe de um tipo modificado: [Peças Sobressalentes (PS)]

- 1 unidade: tubagem do líquido refrigerante :(PS):. 140142280

2 unidades: O-Ring: (PS):. 9645950980

-Novo tipo -

Important safety note

The following technical information and tips for practical use have been set up by HELLA in order to offer professional support to automotive workshops in their daily work. The information available here on this website is only to be used by appropriately trained specialist staff.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.