

# Range Rover Sport V8 - Noise (creaking/squeaking) in the dashboard | HELLA

Range Rover

Sport V8 – 4.2L(2006-2008) and LR3(2005-2008)

Noise (creaking/squeaking) in the area of the dashboard



Solution:

- Lubricate the recirculation driving shafts.
- To do so, remove the glove compartment, the side cover of the audio system, the cover panels of the right centre console and the cover panels of the glove compartment (see photo for positions).
- After removing these parts, turn on the ignition and set the air conditioning to fresh air.

- The driving shafts are now visible.
- Turn off the ignition and lubricate the rods with appropriate lubricant.
- Turn the ignition back on and switch the air conditioning from fresh air to recirculation mode several times (up to 10 times).
- If the noise does not occur any longer, reinstall the parts.