

Ford Focus C-Max - ABS warning light illuminates | HELLA

Ford Focus

Model: C-Max 1.6 16 V TDCI

Model year: from 2006 onwards

All models with ABS/ESP

ABS warning light illuminates

Error code: C1288

Pressure sensor

Current circuit faulty

If the above error is discovered together with an illuminated ABS warning light, this may be due to the brake pressure sensor.

The pressure sensor records the brake pressure in the hydraulic system and relays the value to the control unit. A signal evaluation error leads to the entering of an error in the control unit. As it is not possible to take measurements on the sensor itself, first check the voltage supply and peripheral equipment of the ABS system. If all measurements are consistent with the set values, the pressure sensor must be replaced.

Repair note

The pressure sensor is integrated in the ABS hydraulic unit and cannot be separately replaced.

If damaged, the entire unit must be replaced.

Important safety note

Technical information and practical tips have been compiled by HELLA in order to provide professional support to vehicle workshops in their day-to-day work. The information provided on this website is intended for use by suitably qualified personnel only.

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval and indication of the source. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.