



# VW Transporter T6 - coolant loss

## Data sheet

|                     |                 |
|---------------------|-----------------|
| Manufacturer        | Volkswagen      |
| Vehicle model       | Transporter T6  |
| Engine              | 2.0 TDI         |
| Year of manufacture | 2015 - 2019     |
| Symptoms            | Loss of coolant |

## Important safety note

## Engine losing coolant

Upon identifying a steady coolant loss in the above-mentioned vehicles, check all coolant hose connections and the radiators for leaks. We recommend pressurising the cooling system with a suitable tool according to the manufacturer's specifications.

When identifying the leak, pay special attention to the thermostat housing. Coolant loss here may be caused by a faulty O-ring. When replacing the O-ring, make sure that the contact surfaces on the thermostat housing and engine block are sufficiently cleaned.

The cooling system must then be filled and vented according to the manufacturer's specifications.

## IMPORTANT

Simultaneously also replace the thermostat when replacing the O-ring (06B1211119B)



Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.