

Alfa Romeo 159 (Type 939) - Fejlkode C1131 | HELLA

Alfa Romeo 159 (Type 939) Sedan: VIN 7003555-7053255 Station Wagon: VIN 7003555-7062287 ESP-kontrollampen lyser Fejlkode C1131 Tryksensor for bremsevæske Hvis ovennævnte fejlkode forekommer samtidig med, at ESP-kontrollampen lyser, kan årsagen være en defekt sensor for trykket i bremsevæsken. En fejl i plausibiliteten for tryksignalet medfører her en fejlregistrering i styreenheden. Da det ikke er muligt at foretage en måling direkte på sensoren, kontrolleres først spændingstilførslen og periferikomponenterne i ESP-systemet. Hvis alle testresultater svarer til de foreskrevne værdier, udskiftes tryksensoren. Reparationsanvisning Sensoren for trykket i bremsevæsken er monteret inde i hydraulikenheden og kan ikke udskiftes separat. I tilfælde af defekt skal hele ABS/ESP-hydraulikenheden således udskiftes.

159 (Type 939)

Sedan: VIN 7003555-7053255

Station Wagon: VIN 7003555-7062287

ESP indicator lamp lights up

Error code C1131

Brake fluid pressure sensor

If the error code listed above is discovered together with an illuminated ESP indicator lamp, this may be due to a defective brake fluid pressure sensor. A fault with signal plausibility in pressure evaluation could, in such a case, lead to the entering of an error in the control unit.

As it is not possible to take measurements on the sensor itself, first of all check the power supply and the peripheral equipment of the ESP system. If all the test results

correspond to the set values, the pressure sensor is the probable cause and should be replaced.

Repair note

The brake fluid pressure sensor is mounted inside the hydraulic unit and cannot be replaced as a single item.

Therefore, in the event of any damage occurring, the complete ABS/ESP hydraulic unit has to be replaced.