

Audi A4/A5/A6/A7/Q5/Q7/TT- Nedsat effekt af varme-/klimaanlæg | HELLA

Audi A4/A5/A6/A7/Q5/Q7/TT Årgang: 2011 - 2014
Nedsat funktion af varme-/klimaanlæg
Hvis varme- og/eller klimaanlægget i ovennævnte modeller har nedsat funktion, kan årsagen være vandindtrængen i ledningsnettet. Der kan sive kølevæske ud fra defekte reguleringsventiler for kølevæske (varmesystem, gearkasse) og trænge ind i stikforbindelser og ledninger. Det medfører elektriske fejl og korrosion. Der forekommer hyppigt også andre fejl:
Advarselslampen for kølevæske lyser
For høj motortemperatur
Motoren kører i nødprogram
Fejlkode P2753/P2755
Afhjælpning sker ved at kontrollere alle kølevæskeventiler og deres stik samt elektriske ledninger og evt. udskifte dem.
Følgende modeller kan være berørt heraf:
Model: Årgang: A8 2010 - 2013 Q7 2011 - 2013 A5 Cabriolet 2012 - 2014 TT 2012 - 2014 A4 2012 - 2014 Q5 2012 - 2014 A5 2012 - 2013 A6/A7 2012 - 2013

A4/A5/A6/A7/Q5/Q7/TT

Model years: 2011 – 2014

Loss of power in heating/air-conditioning systems

Should the vehicles mentioned above experience a loss of heating and/or air-conditioning power, water entry into the wiring harness may be the cause.

Due to defective coolant control valves (heating, transmission), coolant can leak and enter the connectors and wiring. This results in electric defects and corrosion. Other defects will frequently occur throughout:

- Coolant warning lamp flashes
- Motor temperature high
- Motor goes into emergency mode
- Error code P2753/P2755

For eliminating the problem, check all coolant valves with their plugs and electric lines and replace where necessary.

The following vehicle models can be affected:

Model: year:

A8

2010 - 2013

Q7

2011 - 2013

A5 convertible

2012 - 2014

TT

2012 - 2014

A4

2012 - 2014

Q5

2012 - 2014

A5

2012 - 2013

A6/A7

2012 - 2013