

Citroën C3 - Elektrisk servostyring er træg | HELLA

Citroën C3 Pluriel Årgang: Fra 04.12.2007 (RPO 11348). Alle modeller med elektrisk servostyring Elektrisk servostyring er træg. Hvis der for disse modeller klages over, at der kræves stor kraft til at betjene den elektriske servostyring, kan momentsensoren til den elektriske servostyring være defekt. Først skal det kontrolleres, om der er oprettet fejlkoder vedrørende momentsensoren til den elektriske servostyring. For at analysere fejlkilden og udelukke andre fejlårsager skal de elektriske forbindelser og kontakterne i ledningsnettets multistik kontrolleres (se illustrationen/ pilene). Desuden skal det sikres, at stikforbindelserne i ledningsnettet er faste. Hvis der ikke forekommer funktionsfejl ved den elektriske analyse, kan tandstangen i den elektriske servostyring være årsag til fejlen.

C3

Pluriel

Model year: 2007-12-04 onwards (RPO 11348).

All models with electric power steering

Sluggish electric power steering.

If it is reported that a large amount of effort must be expended to operate electric power steering for these vehicles, then the torque sensor for the electric power steering may be defective.

Check in advance whether error codes have been stored relating to the torque sensor for electric power steering.

In order to analyse the source of the error and to rule out other causes of the malfunction, the electrical connections and the contacts for the wiring harness multi-plug have to be checked (see Figure/arrows). Furthermore, ensure that the plug connectors are firmly seated on the wiring harness connectors.

If no malfunctions arise during the electrical analysis, then the gear rack for the electric power steering can be taken into consideration as the source of the error.

