

# Honda Jazz - Blæsermotor | HELLA

**Honda Jazz Årgang: 2009 - 2012 Blæsermotor** I ovennævnte modeller kan blæsermotoren svigte delvist. Blæseren kører så kun på højeste trin. Årsagen er oftest, at blæsermotoren bruger for meget strøm. Det medfører, at blæserens regulator beskadiges. Hvis kun regulatoren udskiftes, er der risiko for, at den hurtigt bliver defekt igen. Bilfabrikanten foreskriver, at både regulator og blæser udskiftes. Fejlen afhjælpes på følgende måde: Afmonter den nederste afdækning i fodrummet i passagersiden (venstrestyrede modeller) Afmonter blæseren, og udskift den med en ændret version Afmonter blæserregulatorens, og udskift den med en ændret version Foretag en funktionstest Monter afdækningen igen

## Jazz

**Model year: 2009 - 2012**

### Passenger compartment fan

The vehicles mentioned above may experience a partial failure of the passenger compartment fan. In such cases, the fan will stop running at any level except for full power.

This can usually be traced back to excessive current consumption in the fan motor. This causes damage to the fan controller. If only the controller is replaced, there is a risk of it failing again after a short time.

The vehicle manufacturer intends for both the controller and the fan to be replaced.

Proceed as follows to rectify the problem:

- Remove the lower cover in the passenger footwell (LHD)
- Remove the fan and replace with a modified version
- Remove the fan controller and replace with a modified version
- Perform a functional test
- Replace the cover