

Hyundai Getz - Motoren sætter ud og har ujævn tomgang | HELLA

Hyundai Getz Årgang: 2002 til 2005 Alle modeller med 1,1-motor Udsættere og ujævn tomgang. Hvis der klages over ovennævnte fejl på disse modeller, kan årsagen være en tilsmudset tomgangsregulator. Aflejringer af oliekok på i tomgangsregulatoren kan medføre, at motorstyreenhedens værdier til tomgangsregulering ikke længere kan indstilles rent mekanisk. Fejlen kan afhjælpes ved at rense tomgangsregulatoren med et passende rensmiddel. Desuden skal andre komponenter/aggregater i nærheden (som kan medføre ovennævnte fejl), kontrolleres visuelt for aflejringer af snavs (f.eks.: krumtaphusudluftning, slanger). Det anbefales at udskifte stærkt tilsmudsede aggregater, da rengøring kan medføre skader, og korrekt motorgang dermed ikke kan garanteres.

Getz

Model year: 2003–2005

Engine: 1.1l petrol (G4-HD)

The engine misfires and loses power, the engine malfunction indicator light comes on.

If a customer complains that the engine for the above-mentioned vehicle is experiencing an ignition failure and losing power, and that the engine malfunction indicator light comes on, this might be caused by a worn crankshaft sprocket.

The following error codes may be saved in the 'engine' system's event memory.

Error code `the same as`: