

Hyundai IX 35 - Motoren kan ikke starte | HELLA

Hyundai IX 35 Årgang: 03/2011 Motoren kan ikke starte Starteren virker ikke Ingen fejl i styreenheden Hvis ovenstående fejl konstateres, kan det skyldes en defekt kontakt ved koblingspedalen. Kontakterne (Switch Assy-Ignition Lock, fig.1+2) har til opgave at forhindre start af motoren, hvis koblingen ikke er trådt ned hhv. kun er trådt delvist ned. Kontakterne kan kontrolleres med et diagnoseapparat (parameter-kontrol; måleværdiblokke) samt et multimeter. Afhjælpning: Udskiftning af defekte kontakter. Kontakterne sidder ved koblingspedalen (fig. 3) Kontakt 1 OE nr. 938403K000 Kontakt 2 OE nr. 938402E000 Fig. 3 Fig. 1 Fig. 2

IX 35

Model year: 03/2011

Engine will not start

Starter without function

No fault in the control unit

If the problem described above is determined, the cause could be a faulty switch on the clutch pedal.

The switches (Switch Assy-Ignition Lock, figure 1+2) prevent the engine from starting if the clutch pedal is not actuated or is partially actuated.

The switches can be checked using a diagnostic unit (parameter check, measured value blocks) and a multimeter.

Remedy:

Replace faulty switches.

The switch is located on the clutch pedal (figure 3)

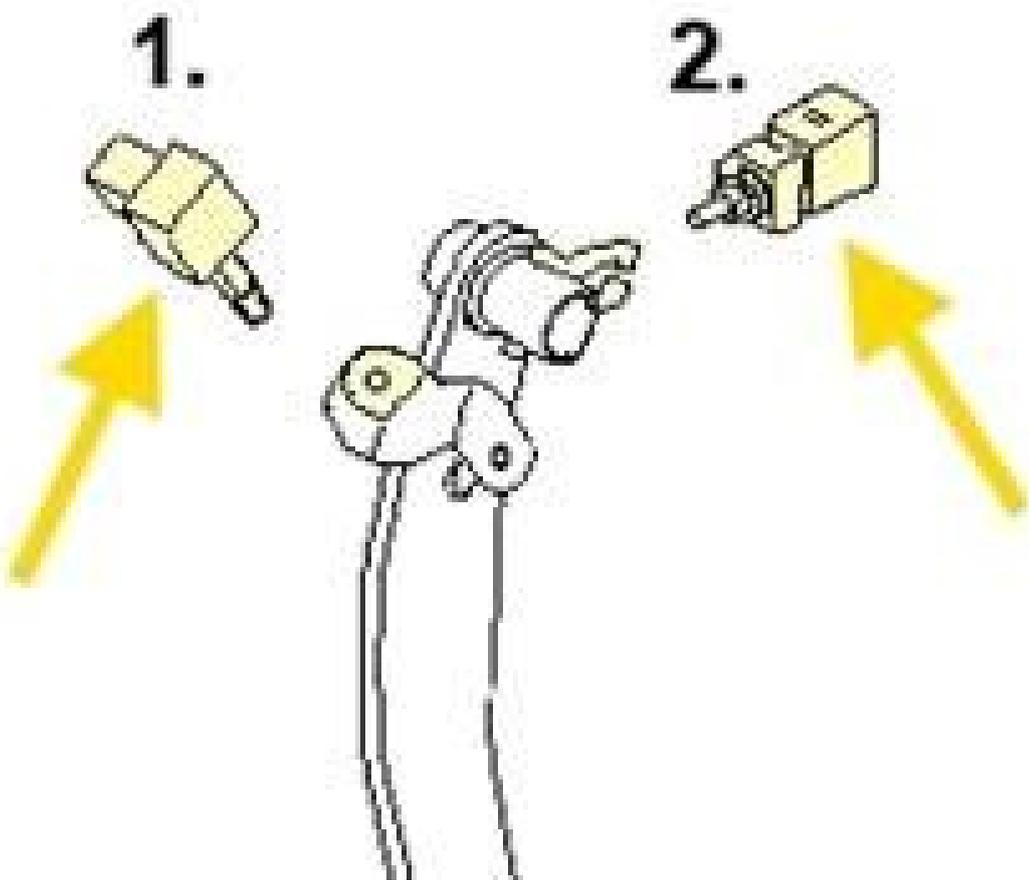


Fig. 3



Fig. 1

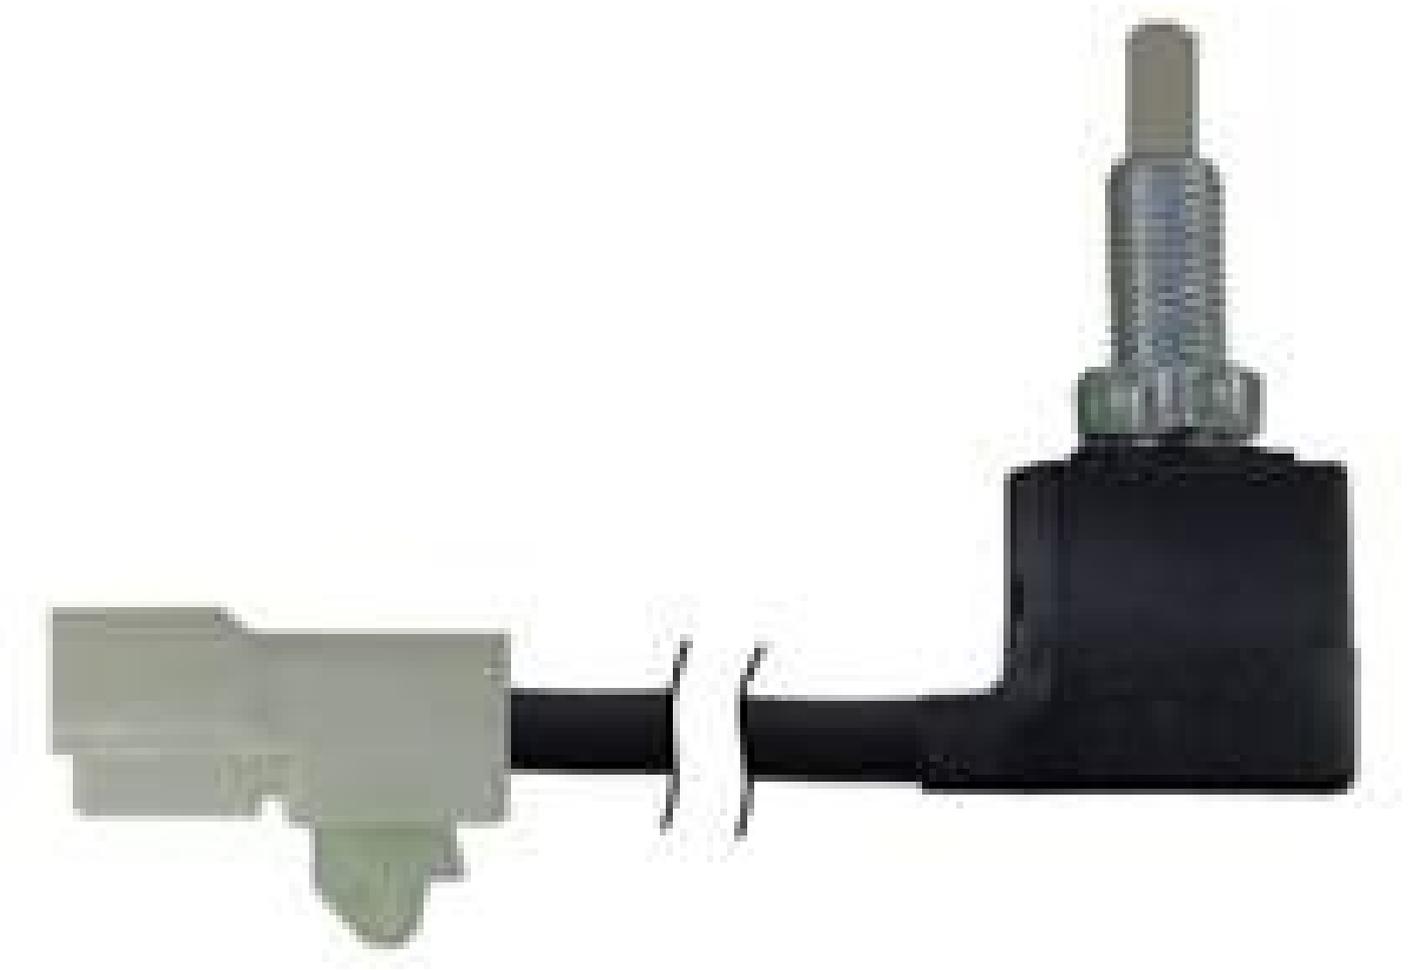


Fig. 2

ⓘ Important safety notice

The following technical information and tips for practical use have been set up by HELLA in order to offer professional support to automotive workshops in their daily work. The information available here on this website is only to be used by appropriately trained specialist staff.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.