

Jeep Compass - Kørelýset dæmpes i den forkerte side | HELLA

Jeep Compass Årgang: 02/2013 - 04/2013 Bi-halogen-forlygter Kørelýset dæmpes i den forkerte side For ovennævnte modeller klages der over, at kørelýset dæmpes hhv. slukkes i den modsatte side af den, hvor blinklyset aktiveres. Årsagen til problemet er i dette tilfælde, at tilslutningerne i stikket i relæboksen i instrumentbordet er ombyttet. Bilfabrikanten har allerede taget sig af problemet, og brugerne af de berørte biler er underrettet. Man må dog af diverse grunde gå ud fra, at ikke alle biler er blevet kontrolleret eller udbedret. På de berørte biler skal værkstedet ombytte placeringen af ledningerne WT/GN = (hvid/grøn) og WT/BL = (hvid/blå) i stikket (relæboks / Instrumentbord).

Compass

Model year: 02/2013 – 04/2013

Bi-halogen headlamps

Daytime running light dims on the wrong side

When the direction indicator is activated on the vehicles mentioned above, customers have complained that the daytime running light dims or switches off on the opposite side.

The reason for this problem is that the connections are the wrong way round on the connector in the dashboard relay box.

The vehicle manufacturer has already addressed the issue and notified the owners of all the affected models. For various reasons, however, it must be assumed that not all vehicles have been checked or modified.

When the affected vehicles are taken to a specialist garage, the positions of the WT/GN (white/green) and WT/BL (white/blue) cables are swapped round on the connector (relay box/ dashboard).