

Mazda 6 - Funktionsfejl for kompressor | HELLA

Mazda6 (GG/GY) Årgang: 2002 - 2008 Motor: 2,0 Di Funktionsfejl for kompressor Hvis der i ovennævnte modeller forekommer funktionsfejl for kompressoren, skal spændingstilførslen til magnetkoblingen kontrolleres. Ledningen til magnetkoblingens spændingsforsyning (+) er ført til kompressoren langs motorblokken. Der kan trænge vand ind i stikket (se illustrationen) og medføre korrosion. Det medfører dårlig kontakt hhv. spændingsfald. Afhjælpning sker ved at udskifte den dårlige elektriske forbindelse.

6 (GG/GY)

Model year: 2002 - 2008

Engine: 2.0 Di

Compressor malfunction

If the compressor in one of the vehicles mentioned above malfunctions, the power supply to the magnetic clutch should be checked.

The electrical cable for the magnetic clutch power supply (+) is routed to the compressor through the engine block area.

Water leaking into the connector housing (figure) can cause corrosion to form. This can lead to contact problems or a power failure.

In order to remedy this issue, the damaged electrical connection should be renewed.

