

Mercedes Benz A-Klasse - Baglygte med reduceret lysstyrke | HELLA Mercedes-Benz A-Klasse Årgang.: 2004 - 2009 Baglygte med reduceret lysstyrke Hvis ovenstående fejl konstateres på ovennævnte model, kan det skyldes dårlig kontakt i fatningen hhv. at forbindelsen er svedet. Fig.1 Fig.2 Fig.1 - før, med reduceret lysstyrke Fig.2 - i orden_ efter reparation. Reparationsvejledning: - Åbn bagklappen - Hægt venstre og/eller højre afdækning (på C-stolpen) af med f.eks. en plastkile. - Åbn dækslet i venstre og/eller højre aflæggerum i bagagerummet. - Tag forbindstasken og den elektriske luftpumpe ud af venstre aflæggerum i bagagerummet (for venstre baglygte) - Klap højre aflæggerum i bagagerummet indefter (for højre baglygte). - Adskil den elektriske stikforbindelse - Kontroller de elektriske ledninger, stik, kabelsko og baglygten for skader, se stik, der er svedet. (Fig. 3). Fig. 3 - Kontroller, at stelforbindelsen er i orden; (der må ikke være korrosion/ overgangsmodstand) se fig. 4. Fig. 4 Udskift fatningen; udskift også stik, kabelsko og tilslutningsledninger om

nødvendigt. (Fig. 5) Fig. 5 Monter delene i modsat rækkefølge .(fig. 6) Fig. 6 Foretag en funktionstest. Afhjælpning: Bilfabrikanten kan levere følgende dele til reparation (fig. 7) - Eksempel: A160 Årg. 2009 - Fatning: A169 820 0777 - Stik A 037 545 3528 - Reparationsledning: A 000 540 2905Fig. 7

1 column area 10668 Warning note BI - 10668

A-Class

Model years: 2004 - 2009

Rear combination lamp with reduced luminosity

If the indicated problem occurs in the above vehicle, a contact problem/ charred bulb holder of the rear combination lamp could be the possible cause.





Fig.1 Fig.2

Fig.1

- before, with reduced luminosity

Fig.2

okay_ after repair.

Repair note:

- Opening vehicle rear door.
 - Unclipping left and/or right cover (C-pillar) using e.g. a long wedge.
 - Opening cover of left and/or right storage compartment in trunk.
 - Removing first-aid kit and electric air pump from left storage compartment in trunk (left rear combination lamp).
 - Folding right storage compartment in trunk inside (right combination lamp).
 - Disconnecting electric plug connection.
 - Checking electric cables, plugs, contacts and the rear light for further damage,
- see charred plug socket. (Fig.3).



Fig.3

- Checking proper ground connection (corrosion/ transition connection) see Fig. 4.



Fig.4

Exchanging bulb holder; respective replacement of plug, plug contacts and electric connecting cable. (Fig. 5)



Fig.5

Assembly in reverse order. (Fig. 6)





Fig.6

Carrying out functional test.

Remedy:

The vehicle manufacturer provides the following repair components here: (Fig. 7)

- Example: A160 m.y. 2009
- Bulb holder: A169 820 0777
- Plug: A 037 545 3528
- Repair connection: A 000 540 2905



Fig.7