

Mercedes Benz A-Klasse - ABS/ESP kontrollampen lyser | HELLA

Mercedes Benz A-klasseType: 168Alle modellerABS/ESP-kontrollampen lyserFejlkode C1201/ C1202Fejl i bremseassistentens (BAS) løsnekontakt, signal ikke plausibeltHvis ovennævnte fejl fastslås, kan årsagen ligge i BAS-løsnekontakten.En fejl under bearbejdning af signalet medfører en fejlregistrering i styreenheden.Da det ikke er muligt at foretage en måling direkte på kontakten, kontrolleres først periferikomponenterne i ABS-systemet. Kan andre fejl ikke fastslås, skal kontakten udskiftes.ReparationsanvisningKontakten er integreret i bremseforstærkeren og kan ikke udskiftes separat.I tilfælde af problemer skal hele enheden derfor udskiftes.

Type: 168

All models

ABS/ESP warning light lights up

Error code C1201/ C1202

Error in braking assistant (BAS) trip switch; signal implausible

If the problem mentioned above is detected, this may be caused by the BAS trip switch.

A signal evaluation error leads to the entering of an error in the control unit.

As it is not possible to take measurements from the switch itself, start by checking the peripheral equipment of the ABS system. If the fault cannot be traced back to any other cause, the switch must be replaced.

Repair note

The trip switch is built into the brake booster and cannot be replaced separately.

As such, the entire unit must be replaced if damaged.