

Mercedes W 204 - Støj fra recirkulationsspjældet | HELLA

MercedesW 204Årgang: fra 2007Støj fra recirkulationsspjældetI ovennævnte modeller kan der forekomme knirkende eller klikkende støj fra fordamperboksen. Årsagen kan være fjedrene ved recirkulationsspjældet.Fejlen afhjælpes på følgende måde:Afmonter afdækningen i højre side under instrumentbrættetAfmontér handskerummet.Afmonter de gamle fjedre til recirkulationsspjældetMonter de nye fjedre (A2048310079), og smør samtidig ophængspunkterneForetag en funktionstestMonter handskerum og afdækning

W 204

Model year: from 2007 onwards

Noises in the circulating air flap

With the above-mentioned vehicle, crackling or clicking noises can occur around the evaporator unit. These noises can very well be caused by the springs on the circulating air flap.

The following steps should be taken to rectify the problem:

- Remove the cover below the dashboard
- Dismantle the glove compartment
- Remove the old springs from the circulating air flap
- Mount the new springs (A2048310079) and grease the fastening points
- Carry out performance check
- Reassemble glove compartment and replace cover