

Mini Cooper - Instrumentgruppe med periodisk funktionsfejl | HELLA

MiniBMW-Mini-CooperÅrgang:11/2003- 01/2004Motorkode: W10 B16AAlle modeller uden navigationssystemInstrumentgruppe med periodisk funktionsfejlHvis der klages over ovennævnte fejl for disse modeller, kan årsagen være en dårlig forbindelse i det 12-benede multistik til instrumentgruppen.Fejlen analyseres ved at foretage en visuel kontrol af det 12-benede multistik til instrumentgruppen. Hvis multistikket har en gennemsigtig afdækning, skal stikket udskiftes med den ændrede udførelse fra bilproducenten.Desuden skal der foretages en visuel kontrol af de elektriske forbindelser / ledninger ved instrumentgruppen for, at stikkene er korrekt i indgreb, og at ledningerne er placeret korrekt.Stikafdækning:Res.nr.: 61.13 8.365.906

BMW Mini Cooper

Model year:

11/2003 - 01/2004

Engine code: W10 B16A

All models without navigation system

Instrument panel with sporadic malfunctioning.

If a complaint is made regarding the above-mentioned fault in one of these vehicles, the possible cause is bad contact on the 12-pin multiple connector of the instrument panel.

Fault analysis is to be carried out by visibly checking the 12-pin multiple connector of the instrument panel. If the multiple connector has a transparent cover, it is to be replaced by the modified model provided by the manufacturer.

In addition, the electrical contacts / leads in the area of the instrument panel are to be visibly checked to ensure proper plugging in and correct cable laying.

Connector cover:

Spare part no.: 61.13.8.365.906