

# Opel Astra-H, Zafira-B - Fejlkode: C0045, C0050 | HELLA

**Opel Astra-H, Zafira-B Alle modeller fra og med Årgang 2005 ABS- kontrollampen lyser Fejlkode: C0045, C0050 Hvis en eller flere fejl forekommer på ovennævnte modeller, kan årsagen være indtrængende vand i stikforbindelserne til hjulomdrejningssensorerne på baghjulene. I så fald skal stikforbindelserne i ledningsbundterne til ABS-sensorerne ved hjulnavene kontrolleres. Hvis der konstateres vandindtrængen eller allerede korrosion i stikkene, skal det pågældende stik samt sensoren udskiftes. Ubeskadigede og nye stikforbindelser skal påføres silikonefedt inden montering.**

## **Astra-H, Zafira-B**

All vehicles starting from model year 2005

The ABS warning lamp lights up

Error code: C0045, C0050

If one or more of the above-mentioned errors occurs in these vehicle models, one potential cause for this may be that water has entered the plug sockets of the wheel rotational speed sensors on the rear axle. In this case, the plug sockets of the cable sets for the ABS sensors must be checked at the wheel hubs. If water has entered at the plug sockets or corrosion is already noticed, the affected plug and sensor must be replaced. Unaffected or new plug sockets should be greased with silicone grease prior to installation.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.