

Opel Astra J - Airbag-kontrollampen lyser | HELLA

Opel Astra J Årgang: 2010 - 2012 Stelnr. – A2000001 /– A8000001 /– C1000001 – A3000001 Airbag-kontrollampen lyser For ovennævnte modeller klages der over, at airbag-kontrollampen lyser. Desuden kan der være lagret følgende fejlkoder: B001A 02 (der betyder: Tændkredsløb for anker i førersæde-selestrammer, kortslutning til stel) B001B 02 (der betyder: Tændkredsløb for anker i passagersæde-selestrammer, kortslutning til stel) En mulig årsag er et beskadiget ledningsbundt til airbag-systemet (ved skinnerne til forreste sædeindstilling). Ledningsbundtet skal kontrolleres for skader. Her skal man især se efter slidmærker. Hvis ledningsbundtet er placeret forkert (markeringen, fig. 1), kan denne skade opstå. Nedenstående arbejder må kun foretages af et sagkyndigt værksted. Udskift selestrammer-enheden Placer og fastgør ledningsbundtet på ny (sørg for, at ledningsbundtet placeres korrekt) Fig. 2 Udskift beklædningen på sædeskinnen Udlæs og slet derefter fejlhukommelsen Fig. 1 Fig. 2

Astra J

Model year: 2010 - 2012

Chassis no. – A2000001 /– A8000001 /– C1000001

– A3000001

Airbag indicator lamp lights up

The criticism has been made that the airbag indicator lamp lights up in the above vehicles.

The following error codes may also be stored:

- B001A 02 (synonymous with: Ignition circuit armature driver's seat belt tensioner, short-circuit to ground)
- B001B 02 (synonymous with: Ignition circuit armature passenger seat belt tensioner, short-circuit to ground)

A possible cause could be a damaged cable strand in the airbag system (in the area of the rail system of the front seat adjustment).

Check the cable strand for damage. In doing so, check in particular for signs of abrasion.

If a cable strand is laid incorrectly (marked in figure 1), it may be damaged.

The work listed below must only be carried out by a specialist garage with the corresponding expertise.

- Replacing the belt tensioner unit
- Re-installation and fastening of the cable strand

(make sure the cable strand is correctly installed)

Figure 2

- Replacing the seat rail cover
- Finally, read out and erase the error memory

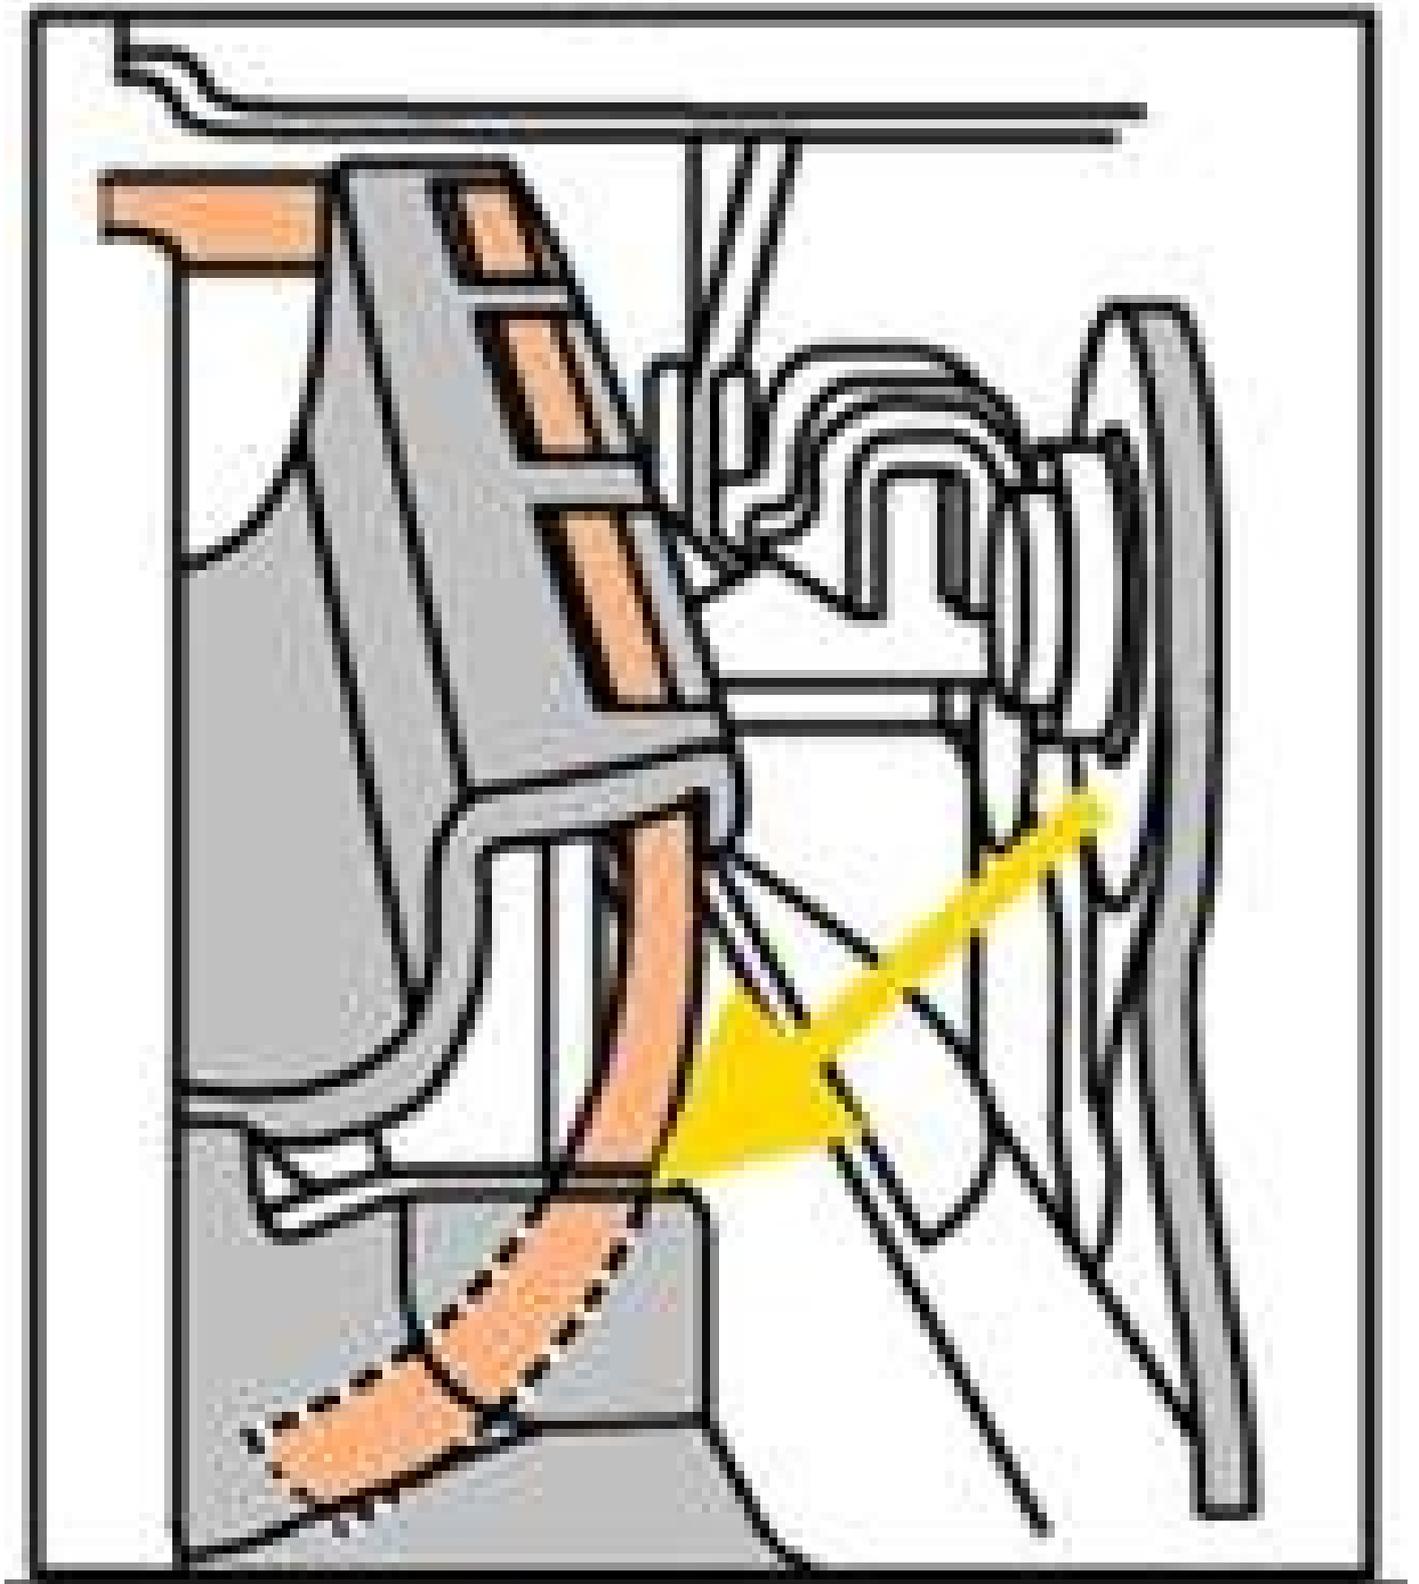


Figure 1

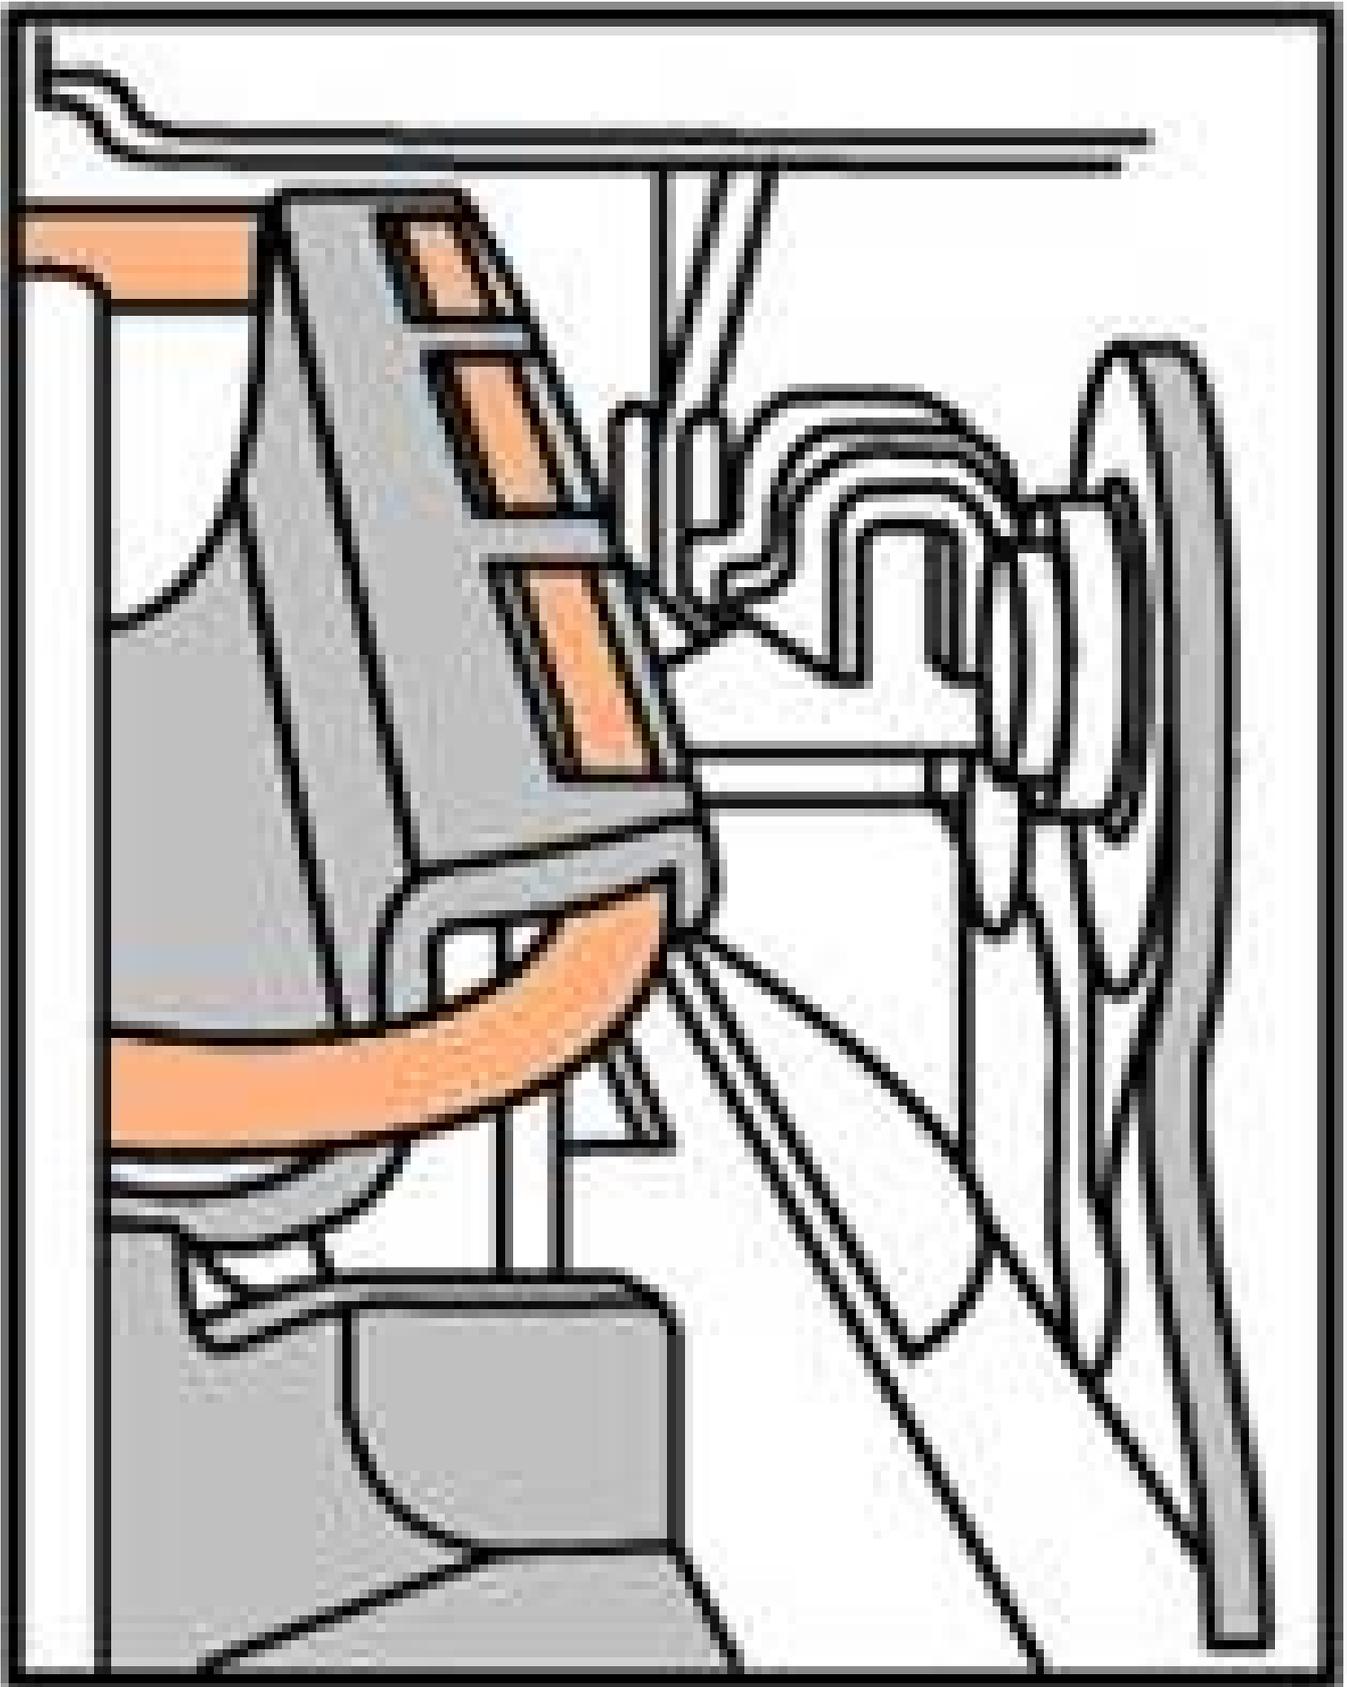


Figure 2