

Opel Astra - Støj fra loftsbeklædningen| HELLA

OpelAstra J GTCÅrgang: 2012Stelnummer_ CG000001

– CG107856Støj fra loftsbeklædningenI ovennævnte modeller reklameres der over støj fra den forreste del af loftsbeklædningen.Årsagen til støjen kan være de clips, der benyttes som hjælp ved montering af panorama-forruden (fig. 1).Clipsene kan løsne sig som følge af f.eks.varmeudvikling (solstråling).Fejlen afhjælpes på følgende måde:· Afmonter loftsbeklædningen som beskrevet i bilfabrikantens reparationsvejledning.· Løsn clipsene (fig. 2, pos. 1) forsigtigt med en plastkile (fig. 2, pos. 2), og fjern dem.Bemærk: brug ikke værktøj med skarpe kanter!· Om nødvendigt kan holdefligene (fig. 2, pos. 3) bukkes nedefter.· Monter loftsbeklædningen igen som beskrevet i bilfabrikantens reparationsvejledning.Efter den 29.08.2012 er clipsene ikke længere benyttet i produktionen.Fig. 1Fig. 2

Astra J GTC

Model year: 2012

Chassis number_ CG000001 – CG107856

Noise in the roof lining area

There have been complaints of noise in the front roof lining area in the vehicles specified above.

The cause of this noise development could be the clips that were used as a mounting aid for the panorama windshield (figure 1).

The clips may come loose due to heat generation (insolation) for example.

Proceed as follows to rectify the problem:

- Remove the roof lining as described in the vehicle manufacturer's repair manual.
- Carefully loosen the clips (figure 2, position 1) using a plastic wedge (figure 2, position 2) and remove them.

<u>Attention: do not use any sharp-edged tools!</u>

- The fixing brackets (figure 2, position 3) can be bent downwards if required.
- Re-install the roof lining as described in the vehicle manufacturer's repair manual.

The clips are no longer used in production as of 08/29/2012.



Figure 1



Figure 2