

# Opel Insignia - Sæde - højdeindstilling defekt | HELLA

**Opel Insignia Årgang: 2009 Sæde - højdeindstilling defekt** Hvis sædehøjdeindstillingen i ovennævnte model ikke fungerer, kan indstillingsspindelen være blokeret. Motoren til højdeindstillingen kan blokere mellem spindel og plaststopklods. En ekstra underlagsskive (1) kan afhjælpe problemet. Fremgangsmåde: Tag sædet ud. Løsn skruen (2) af fjern den. Brug en underlagsskive (1) med dimensionerne 6,4 x 18 x 1,6 (OE-nr. 11035613). Smør den med specialfedt (OE-nr. 13329237). Sæt skruen (2) på plads, og spænd den med 10 Nm. Sæt sædet i

## Insignia

**Model year: 2009**

### Height adjustment system for seating defective

If the height adjustment system for the seating in the vehicle mentioned above no longer functions, it can be the fault of a blocked adjustment spindle.

The motor responsible for the adjusting of the seat height can jam between the spindle and the plastic stopper.

The problem can be solved with the help of an additional washer (1).

Procedure:

- Dismantle seat
- Loosen screw (2) and dismount
- Place washer (1) with the measurements 6.4 x 18 x 1.6 in position (OE No. 11035613)
- Lubricate with special grease (OE No. 13329237)
- Replace screw (2) and tighten with 10 Nm torque
- Remount seat

1



