

Opel Insignia - Tab af kølevæske / termostathus| HELLA

Opel Insignia Årgang: 2012 Motor: A18XER Tab af kølevæske / termostathus Hvis der klages over langsomt tab af kølevæske i ovennævnte modeller, kan årsagen være pakningen mellem termostathus og termostat. Det gælder især modeller med følgende stelnr.: A000001– C1145774 Hvis der konstateres en utæthed på det nævnte sted, afhjælpes den således: Lad kølevæsken køle af Aftap kølevæsken Tag det elektriske stik af termostathuset Afmonter skruerne (4 stk.) til termostathuset Tag huset af Rens pakfladerne Udskift termostat og pakning Monter termostathuset Sæt stikket på Påfyld kølevæske Udluft kølesystemet Foretag en tæthedskontrol

Insignia

Model year: 2012

Engine: A18XER

Loss of coolant / thermostat housing

If, in the above vehicles, it is found that there is a gradual loss of coolant, this may be caused by the seal between the thermostat housing and thermostat.

Vehicles with the following chassis numbers are affected in particular: A000001 – C1145774

If a leak is found in this area, the following remedial action should be taken:

- Allow the coolant to cool down
- Drain coolant
- Disconnect electrical plug at the thermostat housing
- Remove screws (4x) of thermostat housing
- Remove housing
- Clean sealing surfaces
- Replace thermostat and seal
- Fit thermostat housing
- Connect connector
- Refill coolant
- Bleed cooling system

- Carry out leak test