

Opel Insignia - Tab af kølevæske ved EGR-køler | HELLA

Opel Insignia Årgang: 2009 - Motor: A20DT / A20DTH / A20DTJ / A20DTR / A20DTCKølevæsketab ved EGR-kølerI ovennævnte modeller kan der opstå utæthed for kølevæske ved køleren for udstødningsrecirkulation (EGR-køleren). Ved kontrol af kølesystemet skal man være særlig opmærksom på EGR-kølerens hus. Det kan have en revne, som kølevæsken kan trænge ud af. Afhjælpning sker som beskrevet i det følgende, og der benyttes et reparationssæt (illustration) bestående af hus, 2 pakninger og 2 clips: Lad motoren køle af Afmonter EGR-kølerens hus (opsaml kølevæsken) Afmonter EGR-køleren fra huset Rens pakfladerne Brug reparationssættet (res.nr.: 55590953): Monter EGR-køleren i den nye hus Monter kølerens hus, og brug de nye pakninger Påfyld kølevæske Udluft kølesystemet Foretag en tæthedskontrol

Astra J

Model year: 2010 -

Engine: A20DT/A20DTH/A20DTJ/A20DTR

Loss of coolant

The above vehicles can experience a loss of coolant near the exhaust gas recirculation cooler (EGR cooler).

If you suspect a leak in the cooling system, special attention should be paid to the EGR cooler. A crack in the housing can lead to a slow, gradual loss of coolant.

