

Opel Meriva B - Olieutæthed ved kompressoren | HELLA

Opel Meriva B Årgang: 2010 - 2012 Med klimaanlæg Olieutæthed ved kompressoren / tab af kølemiddel ovennævnte køretøjer kan der opstå utæthed ved kompressoren. Det bemærkes oftest ved udsivning af olie / kontrastmiddel. For at afhjælpe problemet skal kompressoren udskiftes til en ændret version: Gamle res.nr.: Erstatte af nye res.nr. 13 271 264 13 395 696 13 271 266 13 395 693 13 271 267 13 395 694 13 271 268 13 395 695 13 271 269 13 395 696 Fra årgang 2012 hhv. stel nr. B4408747 monteres der på fabrikken ændrede kompressorer. Hella kompressorer er uden undtagelse ændret og udviser ikke ovennævnte problem. I tabellen sammenholdes OE- og BHS-nr. til sammenligning. Originalt res.nr. BHS-res.nr. GM133956968FK 351 340-241 GM133956948FK 351 340-251 GM133956968FK 351 340-271 GM133956958FK 351 340-361 GM133956938FK 351 340-371 Opel16184258FK 351 340-241 Opel16184238FK 351 340-251 Opel16184258FK 351 340-271 Opel16184248FK 351 340-361 Opel16184258FK 351 340-241 Opel16184228FK 351 340-371 Vauxhall133956968FK 351 340-241 Vauxhall133956948FK 351 340-251 Vauxhall133956968FK 351 340-271 Vauxhall133956958FK 351 340-361 Vauxhall133956968FK 351 340-241 Vauxhall133956938FK 351 340-371

Meriva B

Model year: 2010 - 2012

With air-conditioning system

Loss of oil from the compressor /

Loss of refrigerant

The above-mentioned vehicles can experience a compressor leakage. This is mostly noticeable by escaping oil/dye. To fix this problem, the compressor must be exchanged for a modified version:

Old Part No: Replaced By New Part No:

13 271 264 13 395 696

13 271 266 13 395 693

13 271 267 13 395 694