

# Opel Vivaro - ABS-service-/stop-advarelslampen lyser ukontrolleret under kørslen | HELLA

Opel Vivaro Alle modeller Årgang 2001 - 2003 ABS-service-/stop-advarelslampen lyser ukontrolleret under kørslen Der er ikke gemt nogen fejlkoder i styreenheden Hvis den ovennævnte fejl konstateres, kan årsagen være en defekt viskermotor. Viskermotoren skaber interferenser, som kan medføre forstyrrelser, som igen kan føre til at, ABS-advarelslampen lyser. Reparationsanvisning Ved reparation anbefaler vi følgende fremgangsmåde: Kontrollér ABS-systemet, og kontrollér, at fejlen ikke kan skyldes andre årsager. Kontrollér viskermotoren, og udskift den om nødvendigt. Hvis viskermotoren fortsat er fuldt funktionsdygtig, fås der som alternativ et støjfilter fra producenten. Filteret integreres i viskermotorens elektriske tilslutning og kan filtrere hhv. undertrykke disse forstyrrelser. Reservedel: Støjdæmpningsfilter 90513022 Følg i denne forbindelse altid køretøjsproducentens reparationsanvisninger!

**All models**

**Model years 2001-2003**

**Uncontrolled illumination of the ABS Service- Stop warning light while driving**

**No error code stored in the control unit**

If the above defect is noticed, the cause may be a faulty windshield wiper motor.

The windshield wiper motor creates interference which can result in malfunctions and illumination of the ABS warning light.

**Repair notes**

In case of repair, we recommend the following procedure:

- Check the anti-blocking system and make sure that there is no other cause for the defect.

- Check the wiper motor and replace if necessary

If the wiper motor is still fully functional, a suppression filter is alternatively offered by the vehicle manufacturer. The filter is incorporated in the electrical connection of the wiper motor and can filter out / suppress such malfunctions.

Spare part: Suppression filter 90513022

Please follow the repair information for the vehicle manufacturer in this regard.