

Opel Vivaro - Fejlkode P0100 Luftmassemåler | HELLA

Opel Vivaro 1,9DI/1,9DTI Motorkode F9Q-760 , F9Q-762 Årgang
2001 til 2007 Motorkontrollampen lyser Fejlkode P0100

Luftmassemåler Startvanskeligheder Hvis ovennævnte fejlsymptom konstateres kort efter en skade på turboladeren, kan det have forbindelse med forureninger i ladeluftsystemet. Ved en skade på turboladeren kan fine, afslidte metalpartikler eller spåner være blevet i indsugningssystemet. Disse forureninger suges ind og kan beskadige målefolien i luftmassemåleren. I nogle tilfælde kan fejlsymptomerne også først forekomme 2 til 3 uger efter udskiftning af turboladeren. Reparationsanvisning For at undgå evt. følgeskader efter udskiftning af turboladeren, skal indsugningssystemet først kontrolleres og om nødvendigt renses. Yderligere informationer findes i teknisk information „Udskiftning af ladeluftkøler efter en defekt i turboladeren“

Vivaro 1.9DI / 1.9DTI

Engine code F9Q-760, F9Q-762

Model year: 2001 to 2007

Engine control light is on

Error code P0100 air mass sensor

Poor starting behaviour

If the above-mentioned fault pattern is discovered shortly after damage has occurred to the turbocharger, the problem can stem from contamination in the charge air system. In the event of damage to the turbocharger, fine particles of metal debris or chips can remain in the intake system. These contaminants are drawn in and can damage the measuring foil of the air mass sensor. In some cases such a fault pattern only manifests itself 2 to 3 weeks after the renewal of the turbocharger.

Repair information

In order to avoid possible subsequent damage after the changing of the turbocharger, the intake system should be checked beforehand and cleaned if necessary.

Further information can be found in the technical information:

"Replacing a charge air cooler following a turbocharger defect"