

Opel Vivaro - Motorkontrollampen lyser | HELLA

Opel Vivaro Årgang: 2011 - 2013 Stelnr: BV600001–DV602062 Motorkode: M9R-630 Motorkontrollampen lyser. For ovennævnte modeller klages der over, at motorkontrollampen lyser ved langvarig kørsel ned ad bakke. Desuden lagres der i motorstyreenheden fejlkodeerne P0201, P0202, P0203 og P0204 (der betyder: indsprøjtningdyse / dyse 1-4, funktionsfejl i el-kredsløb). Årsagen kan være forkert kalibrering af motorstyreenheden. Bilfabrikanten har allerede taget sig af problemet. En software- opdatering er til rådighed fra uge 5 / 2013. Fra 26.11.2012 og stelnummer WOLF7B1AEDV602062 benyttes der i produktionen en ændret software.

Vivaro

Model year: 2011–2013

Chassis no.: BV600001 – DV602062

Engine code: M9R-630

The engine warning light illuminates.

On the vehicle specified above, a complaint has been made that the engine warning light illuminates when traveling downhill over longer distances.

In addition, error codes P0201, P0202, P0203 and P0204 (synonymous with: injection valve / nozzle 1-4, power circuit malfunction) are stored in the engine control unit.

The cause could be a faulty calibration of the engine control unit.

The vehicle manufacturer has already addressed the issue.

A software update is available from CW 5 / 2013.

A changed software shall be used in the production from November 26, 2012 and chassis number WOLF7B1AEDV602062.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.