

# Peugeot 207 - Motorkontrollampen lyser | HELLA

**Peugeot207Årgang: fra 2008Motor: 1,6i VTi /S16 5FWMotorkontrollampen lyserMotoren går ujævnt tager gassen dårligt.Hvis der for ovennævnte modeller klages over, at motorkontrollampen lyser, og motoren går ujævnt hhv. accelererer dårligt, kan årsagen være sensoren for kølevæsketemperatur. Der kan være lagret følgende fejlkoder i styreenheden: Fejlkoden betyder:- P0122,`Gasspjæld,- Gaspedalsensor eller kontakt A, signal for lavt`.- P0131,`Lambdasonde Bank 1, signal for lavt`.En funktionsfejl kan udløses af en utæthed inde i den 2-polede sensor for kølevæsketemperaturen (der er indbygget i den elektriske termostat). Desuden er det muligt, at kølevæsken som følge af kapillareffekten trænger ind i ledningsbundtet hhv. ind i styreenheden, hvilket medfører problemer i de elektriske / elektroniske systemer.Hvis der ved denne kontrol/visuelle kontrol konstateres vand i ledningsbundtets kappe hhv. oxidation i styreenheden og i styreenhedens stik, skal styreenheden også kontrolleres/udskiftes.Sensoren for kølevæsketemperatur findes i Hella reservedelsprogrammet. Res.nr.: 6PT 009309-221Inden reparationen anbefales det at kontrollere signalerne hhv. signaloverføringen for gaspedal-, gasspjældssensoren og lambdasonden med henblik på lagrede fejlkoder og derefter slette fejlkoderne.**

**207**

**Model year: from 2008**

**Engine: 1.6i VTi/S16 5FW**

**The engine malfunction indicator light is activated.**

**The engine is juddering and accelerates poorly.**

If a customer complains that the engine malfunction indicator light, for the above-mentioned vehicle, is activated and the engine judders or accelerates poorly, the possible source of error

could be the coolant temperature sensor. The following error codes may be stored: Error code `the same as`:

- P0122, `Throttle valve sensor, accelerator pedal sensor or switch A, signal is too low`.

- P0131, `Lambda sensor bank 1, signal is too low`.

A malfunction could be triggered by a leak inside the 2-pin coolant temperature sensor (which is installed in the electrical thermostat). It is also possible that cooling water has entered the wiring harness or the control unit through a capillary effect, causing problems in the electrics/electronics.

If during this inspection/visual check, water is detected in the wiring harness casing or oxidation is detected on the control unit and connectors, then the control unit must also be checked/replaced.

The coolant temperature sensor is available from the Hella spare part product range. Spare part no.: 6PT 009309-221

Before carrying out the repair it is recommended that you check the signals and the signal transmission for the accelerator pedal sensor, throttle valve sensor and lambda sensor with regard to the stored error codes, and that you then delete the error codes.