

# Saab 9-3 - Tab af kølevæske | HELLA

Saab 9-3 Sedan/ st. car Motorkode B284 Stelnummer: 61000001–81107480. Tab af kølevæske For ovennævnte modeller kan blive klaget over tab af kølevæske. Årsagen kan være en fejl ved ekspansionsbeholderen hhv. beskadigede kølevæskeslanger ved ekspansionsbeholderen. Disse komponenter (fig. 1) er placeret meget tæt på turboladeren, hvorved materialerne udmattes som følge af høj omgivende temperatur. Afhjælpning sker ved at udskifte ekspansionsbeholderen og udskifte/omplacere slangerne ved ekspansionsbeholderen. Hertil kan bilfabrikken levere ændrede kølevæskeslanger (se fig. 2). Res.nr. 93 194 927- 1 sæt kølevæskeslanger Res.nr. 12 759 330- 1 ekspansionsbeholder Fig. 1 (gammel udførelse) Fig. 2 (ændret udførelse)

9-3

Sedan / Estate

Engine code: B284.

Chassis no. : 61000001 – 81107480.

## Loss of coolant

In the case of the above-mentioned vehicles, problems can arise because of loss of coolant. The cause of this can either be a defective coolant expansion tank or damaged engine coolant hoses on the coolant expansion tank.

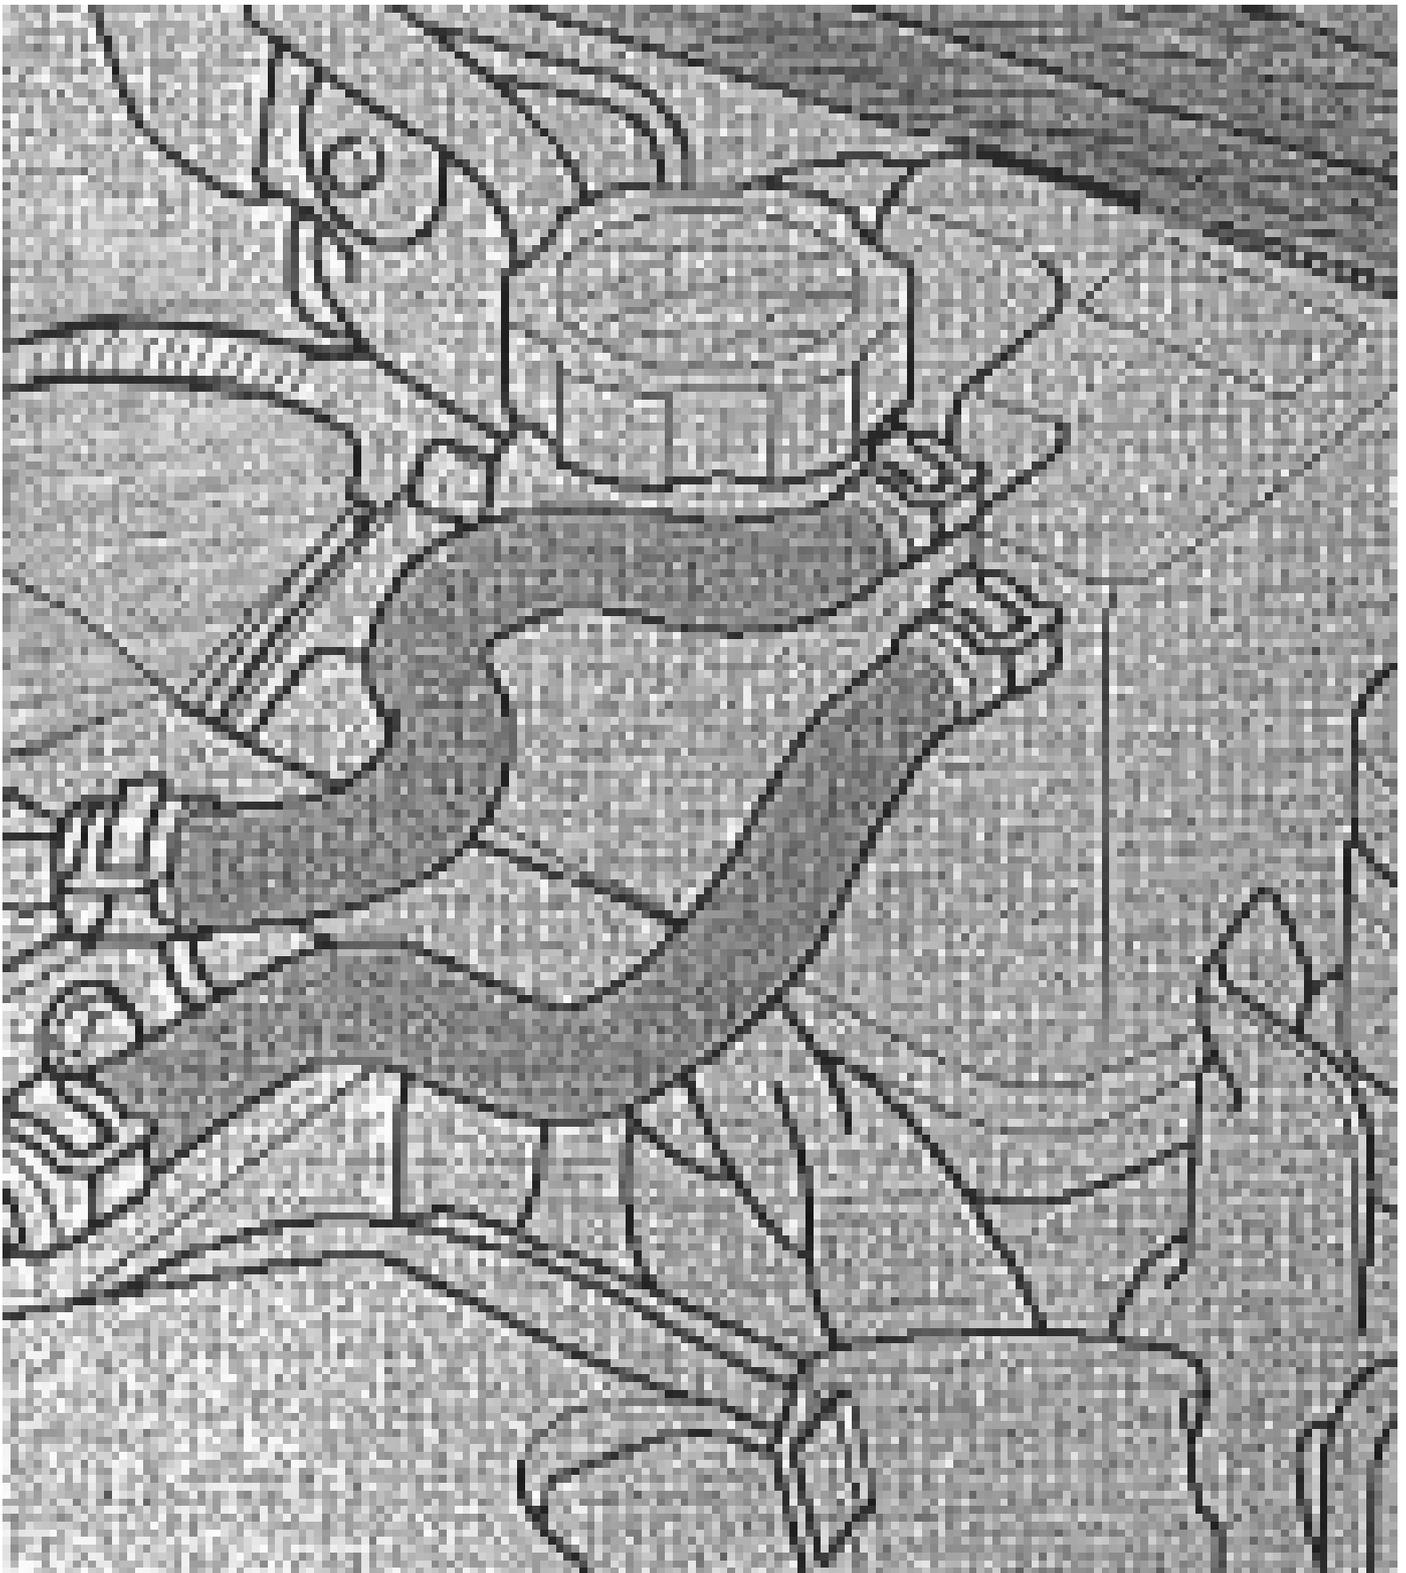


Figure 1

(Old layout)

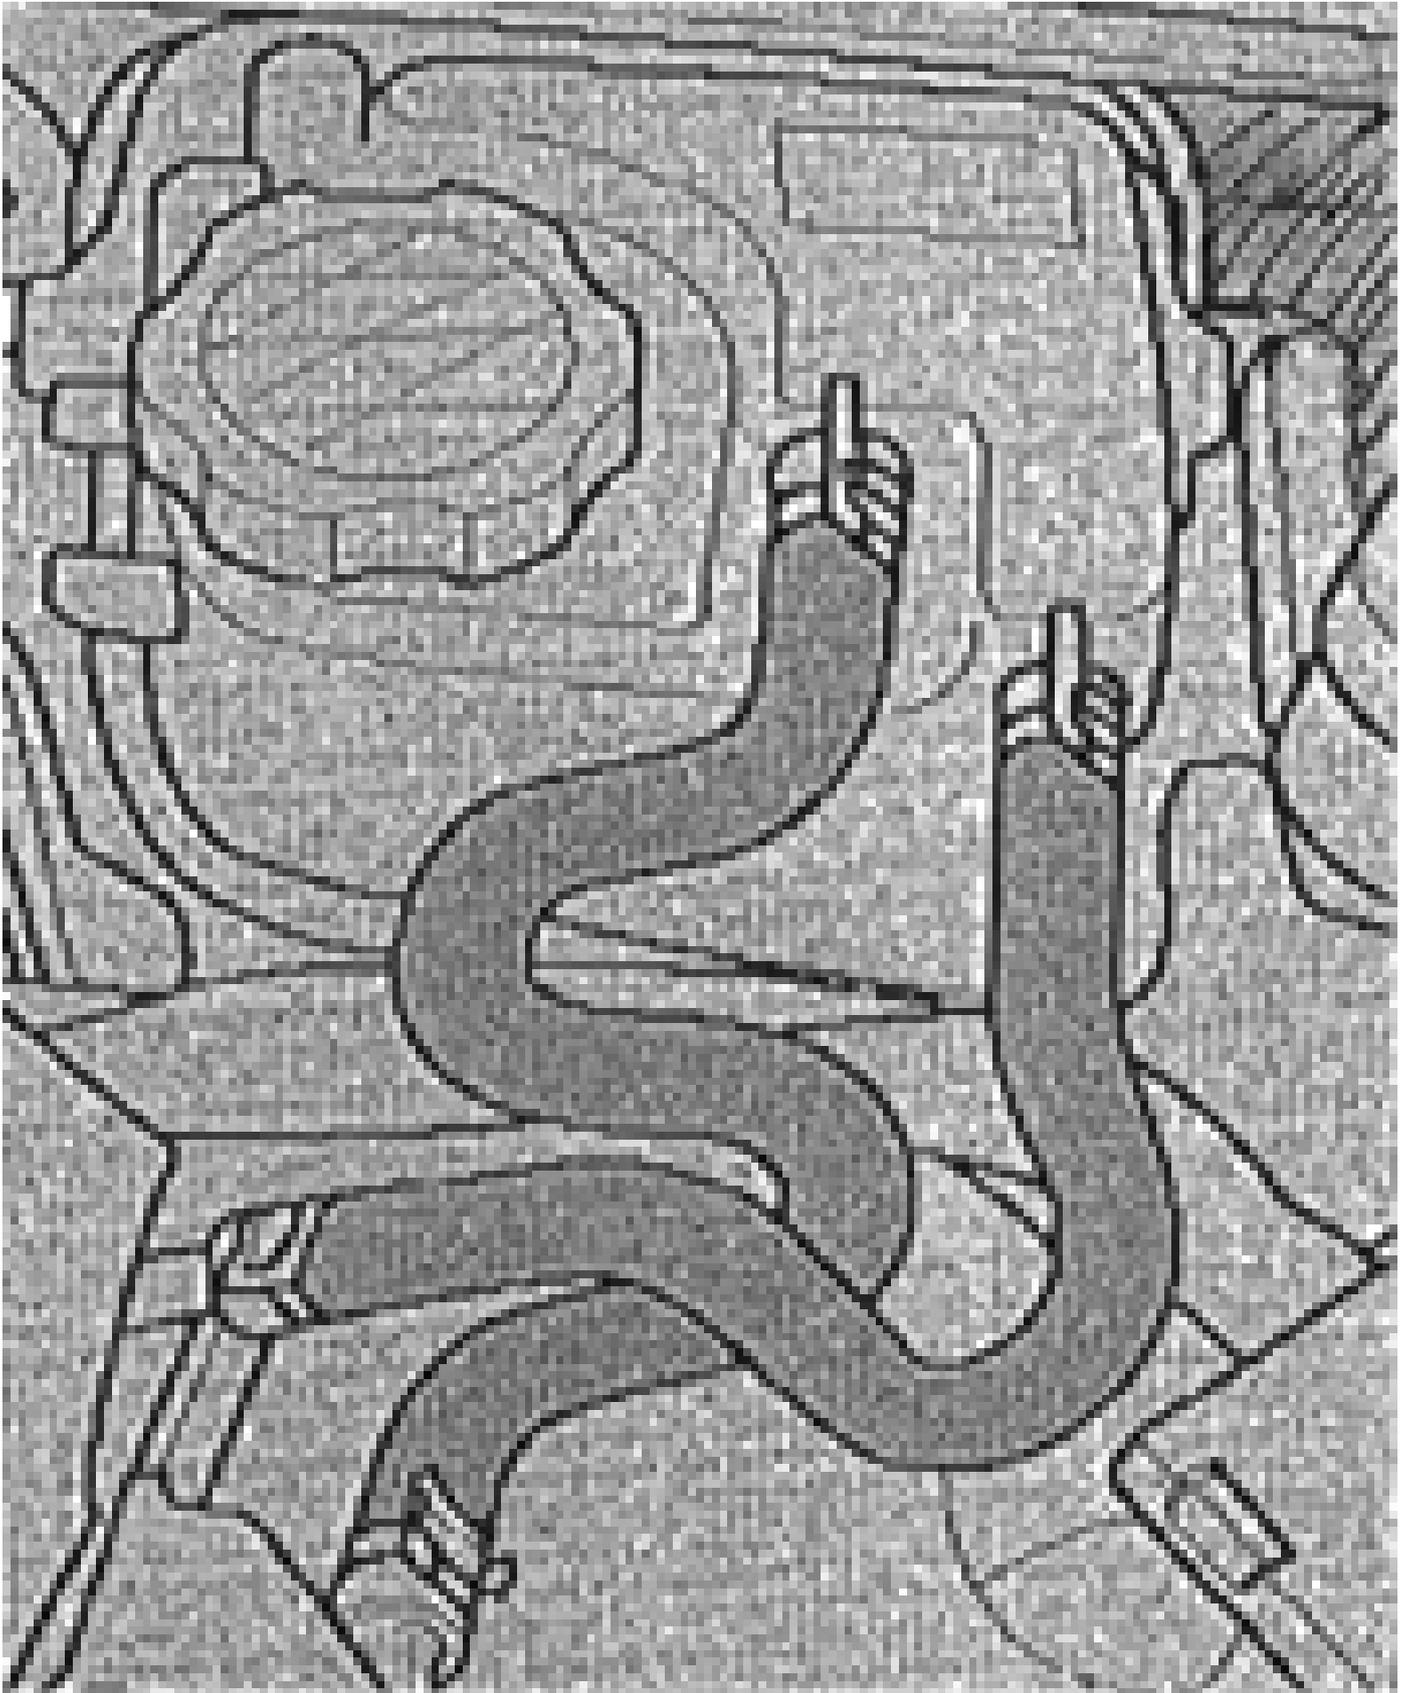


Figure 2

(Modified layout)

## **Important safety note**

The following technical information and tips for practical use have been set up by HELLA in order to offer professional support to automotive workshops in their daily work. The information available here on this website is only to be used by appropriately trained specialist staff.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.