

# Suzuki Swift - Motorkontrollampen lyser | HELLA

**Suzuki Swift (SG) Alle modeller fra årgang 2006 - 2010 Motorkontrollampen lyser** Hvis den ovennævnte fejl påpeges af kunden, kan EGR-ventilen være årsagen. Desuden kan der være lagret fejlkode P0400 i fejlhukommelsen (udstødningsrecirkulations-system, funktionsfejl ved gennemløb er konstateret). Tilkoksning og andre aflejringer forårsager, at ventilen hænger. Følg i så fald følgende fremgangsmåde:- Afmonter EGR-ventilen og rens den grundigt med passende midler.- I tilfælde af kraftig tilsmudsning skal udstødningsmanifolden også afmonteres og renses.- Efter rensning monteres de afmonterede dele igen med nye pakninger.- Foretag derefter en systemtest. Slet fejlhukommelsen.

## Swift (SG)

### All models from model years 2006-2010

If a customer complains about the above error, this could be caused by the EGR valve. Error code P0400 (exhaust gas recirculation system, continuity malfunction identified) may be saved in the event memory. Coking and other deposits cause the valve to jam. In this case, proceed as follows:

- Remove the EGR valve and clean it thoroughly with appropriate products.
- If contamination is severe, the exhaust manifold must also be removed and cleaned.
- After cleaning, refit the parts that have been removed with new seals.
- Carry out a system check.
- Delete the event memory.