

Toyota Auris, Corolla - Klaprende lyde fra forhjulsbremserne| HELLA

Toyota Auris, Corolla Alle modeller med 15-tommer forhjulsbremser Klaprende lyde fra forhjulsbremserne ovennævnte modeller kan der forekomme klaprende lyde fra forhjulsbremserne ved kørsel på ujævn vej. Støjen forsvinder, hvis bremsepedalen trædes let ned. Årsagen kan være den konstruktive opbygning af holderen til bremsekalibren. Bilfabrikanten tilbyder for sådanne tilfælde ændrede holdere til bremsekalibrene med ændrede føringsbolte og støvmanchetter. Afhjælpning Foretag en visuel kontrol. Kontroller forhjulsbremserne for skader, fejlfri funktion, stærk tilsmudsning og slid. Om nødvendigt adskilles bremserne delvist til yderligere kontrol. Hvis der ikke konstateres fejl, skal holderne til bremsekalibrene kontrolleres og evt. udskiftes med de ændrede komponentsæt. Ændringerne kan ses på de ændrede føringsbolte med bøsning. (Illustration) I den forbindelse skal bilfabrikantens vedligeholdelses- og reparationsanvisninger altid følges! Bemærkning Følgende modeller er berørt. Modelkoder: NDE180, NRE180, NRE185, WWE185, ZRE181, ZRE182, ZRE185 og ZWE186 Bilfabrikanten tilbyder følgende OE-reservedele til afhjælpning af fejlen som led i en afhjælpningsprocedure: Holder til bremsekaliber 47721-09560

Auris, Corolla

All models with 15-inch front wheel brake

Rattling noises at the front axle wheel brake

On the vehicle models mentioned above, rattling noises may occur at the front axle wheel brake when driving on uneven road surfaces. If the brake pedal is depressed slightly, the noises disappear.

This may be caused by the design of the brake calliper carrier. The vehicle manufacturer offers modified brake calliper carriers with modified guide bolts and dust protection collars for these scenarios.

Corrective measure

Carry out a visual inspection. Check front axle brake system for damage, proper function, excessive dirt or wear. If necessary, partially disassemble the wheel brake for further inspection. If no defects can be diagnosed, check the brake calliper carriers and, if necessary, replace them with the modified parts sets.

The retrofit can be identified from the modified guide bolts with bush. (Image)

As part of this, please always observe the maintenance and repair notes provided by the vehicle manufacturer.



Please note

The following vehicles are affected.

Model codes: NDE180, NRE180, NRE185, WWE185, ZRE181, ZRE182, ZRE185 and ZWE186

To remedy the defect, the following OE spare parts have been offered by the vehicle manufacturer as part of a corrective measure:

- Brake calliper carrier 47721-09560

Important safety note

Technical information and practical tips have been compiled by HELLA in order to provide professional support to vehicle workshops in their day-to-day work. The information provided on this website is intended for use by suitably qualified personnel only. Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval and indication of the source. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.