

Volkswagen Golf V Plus - ABS/ESP kontrollampen lyser | HELLA

Volkswagen Model: Golf V Plus
Motorcode: BLF
Årgang: 2005-2009
ABS/ESP-kontrollampen lyser
Fejlkode: 1435
Bremsetryksensor 1G201
Hvis ovennævnte fejlkode forekommer samtidig med, at ABS-kontrollampen lyser, kan årsagen være sensoren for trykket i bremsevæsken. Tryksensoren registrerer trykket i det hydrauliske bremsesystem og sender værdien til styreenheden. En fejl under bearbejdning af signalet medfører en fejlregistrering i styreenheden. Da det ikke er muligt at foretage en måling direkte på sensoren, kontrolleres først parametrene. Værdien skal være 0, når der ikke trædes på bremsepedalen. Hvis værdien er forskellig fra 0 (fig.), skal sensoren udskiftes.
Reparationsanvisning
Tryksensoren er integreret i ABS-hydraulikenheden. Bilfabrikanten kan levere et reparationssæt til ABS-hydraulikenheden.
Bemærk
Denne information kan også benyttes til andre modeller med tilsvarende ABS-systemer.

Model: Golf V Plus

Engine code: BLF

Model year: 2005 – 2009

ABS/ESP warning light illuminates


Error code: 1435

Brake pressure sensor 1G201

If the above error is discovered together with an illuminated ABS warning light, this may be due to the brake fluid pressure sensor.

The pressure sensor records the brake pressure in the hydraulic system and relays the value to the control unit. A signal evaluation error results in an error being entered in the control unit. As it is not possible to take measurements on the sensor itself, first of all check the parameters in this case. The setpoint should be 0 bar when the brake is not applied.

The sensor must be replaced in the event of deviating values (figure).

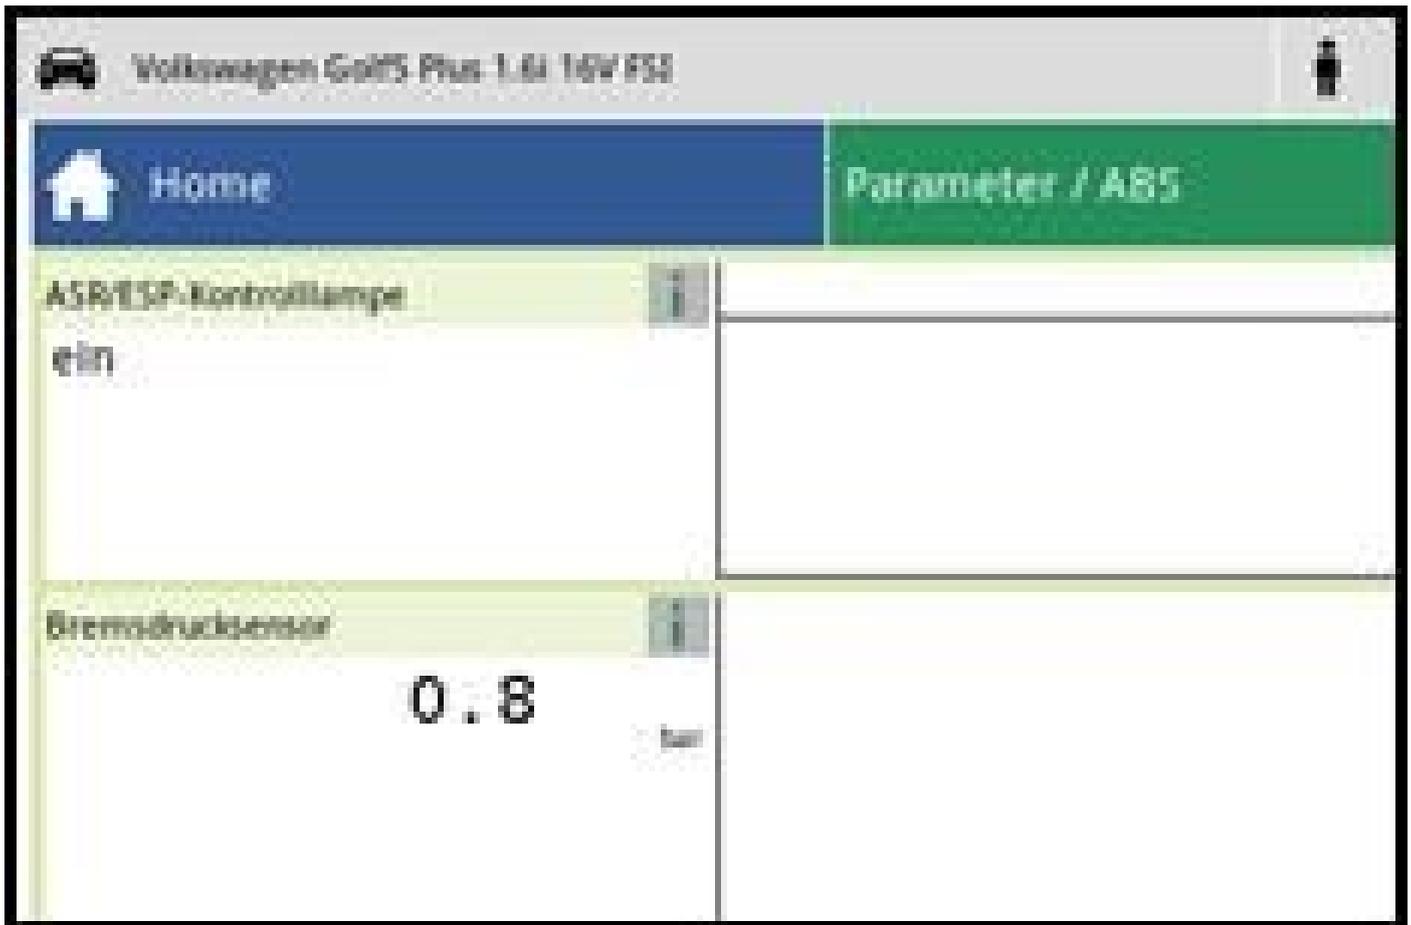

Repair note

The pressure sensor is integrated in the ABS hydraulic unit.

The vehicle manufacturer offers a repair kit for the ABS hydraulic unit.

Note

This information can also be applied to other models with identical ABS systems.