

VW Golf 6 Plus - Dårlig accelerationsevne | HELLA

VW Golf 6 Plus

Alle modeller


Årgang 2010-2014

Dårlig accelerationsevne

Motorkontrollampen lyser

Fejlkoder: P0225, P1630, P2122

Hvis ovennævnte fejl konstateres sammen med de nævnte fejlkoder, kan årsagen være fejl i stikforbindelsen ved gaspedalsensoren.

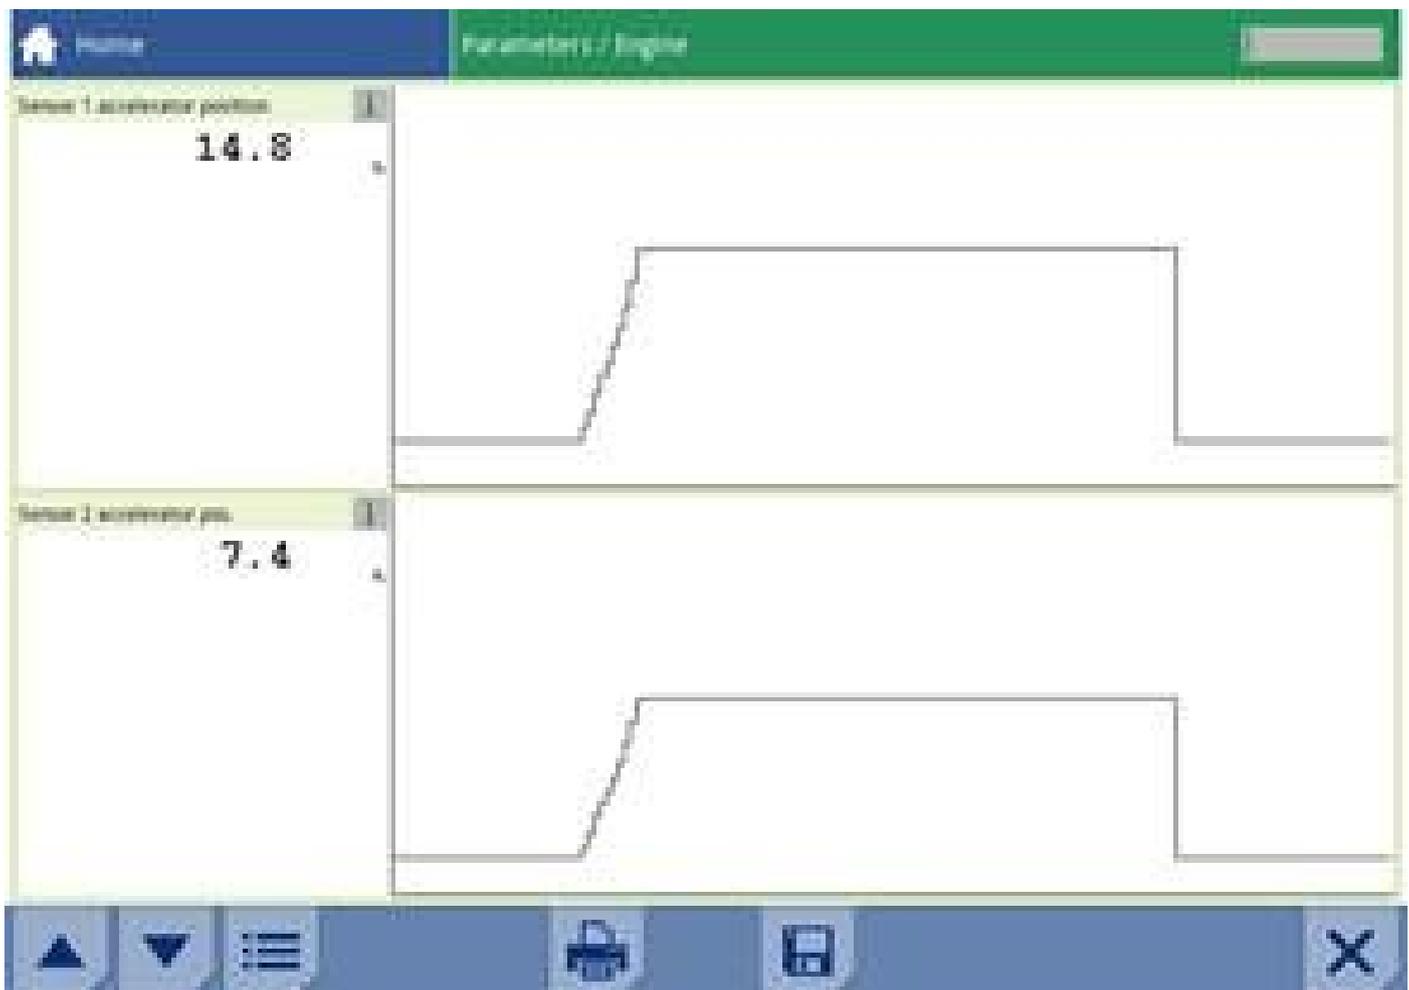

- Træk stikket i ledningsnettet af gaspedalsensoren, og kontroller det for løse eller defekte terminaler. Reparér eller udskift defekte komponenter
- Kontroller, at gaspedalføleren fungerer korrekt. Det gøres ved at fremkalde og bedømme signalforløbet på diagnoseapparatet
- Slet fejlkoderne, og prøvekør bilen

Important safety notice

The following technical information and tips for practical use have been set up by HELLA in order to offer professional support to automotive workshops in their daily work. The information available here on this website is only to be used by appropriately trained specialist staff.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.