

VW T5 - Funktionsfejl i bagrudeviskeren | HELLA

VW T5, Transporter
Årgang: fra 2003
Alle modeller med fløjdøre bag.
Funktionsfejl i bagrudeviskeren. I nogle af ovennævnte modeller kan der forekomme forskellige fejl som følge af en defekt i en af bagrudeviskermotorerne. Det gælder både funktionen af bagrudeviskerne og forrudeviskerne. Af og til kører bagrudeviskerne konstant og/eller de reagerer ikke på de forskellige stillinger af kontaktarmen under rattet. Der er ikke nødvendigvis lagret fejlkoder i styreenheden. Fejl i en bagrudeviskermotor kan skyldes vandindtrængen via viskerakslen. Kraftig oxidering hhv. fugtighed i det indre kan medføre „elektromigration“ hhv. konstant plus. I så fald kan strømtilførslen til viskermotorerne på bagruderne, der er årsag til fejlen, i første omgang afbrydes, således at forrudeviskerne virker, i hvert fald indtil der monteres ny bagrudeviskermotor. I så fald skal bagrude-viskermotoren/-viskermotorerne udskiftes.

T5, Transporter

Model year: 2003 onwards

All models with rear double-wing doors.

Malfunction of rear window wipers.

With some of the above-mentioned vehicles, a fault in one of the rear window wiper motors can lead to various malfunctions of the system. These affect the functioning of both the rear window wipers and also the front windscreen wipers. In some cases, the rear window wipers work non-stop and/or they do not react to the various settings on the steering column switch.

Fault codes are not necessarily stored in the control unit.

Defects in the rear window wiper motor can be caused by water entering via the wiper shaft. Severe oxidation or dampness in the interior can lead to "electromigration" or to a permanent positive connection.

In such a case the wiper motors at the rear, as the culprits causing the problem, can first of all be disconnected so that (until the motors are replaced) at least the front windscreen wipers can function properly.

In this situation, the rear window wiper motor(s) has(have) to be replaced.