

VW Tiguan - Blæsermotoren virker ikke | HELLA

VW Tiguan (5N) Årgang: fra 2007 Blæsermotoren virker ikke i ovennævnte modeller kan blæsermotoren fryse ved lave udendørs temperaturer og samtidigt fugtigt vejr. Hvis der trænger fugtighed (vand, sne) frem til blæsermotoren via luftindtaget, kan det forårsage fejl i ventilationssystemet. Fugtigheden fryser ved længere tids stilstand og blokerer dermed blæsermotoren, indtil den igen er „tøet op“. Som følge heraf kan blæserregulatoren blive ødelagt. Blæseren kører så kun med maks. omdrejningstal. Fejlen afhjælpes på følgende måde: Kontroller blæseren for indtrængende fugtighed. Kontroller blæserregulatoren, udskift den om nødvendigt. Afhjælp fugtindtrængen (bilfabrikanten benytter ændrede komponenter)

V70 III (Type 24) T6

Model year: 2007-2013

Engine: 3.0i V6

With the vehicles specified above, the low pressure service connection of the air-conditioning system cannot be found immediately.

The connection is located on the front passenger side underneath the water tank cover (see figure).

As it is very complicated to remove the cover completely, we recommend that this is raised and locked in place with an appropriate object.