

# VW Touareg (7P5) - Klemme 15 svigter periodisk | HELLA

VW Touareg (7P5) Årgang: 2012 Klemme 15 svigter periodisk  
Årsagen til, at klemme 15 (plus via tændingen) periodisk svigter, er i dette tilfælde en defekt relæholder i hovedsikringsboksen.  
Reparationsvejledning: Kontroller produktionsdatoen for hovedsikringsboksen. Gælder kun hovedsikringsbokse (under førersædet) med følgende produktionsdato 25.11.2011.  
Udskift hovedsikringsboksen. OE-nr. 7P0 937 548F (ikke-hybrid) OE-nr. 7P0 937 548G (til hybrid)  
Hvis hovedsikringsboksen allerede er udskiftet i forbindelse med en aktion fra fabrikanten, er det angivet med en mærkat i reservehjulsbaljen og dokumenteret i servicehæftet.

## Touareg (7P5)

Model year: 2012

### Terminal 15 fails sporadically

The cause of failure for terminal 15 (switched plus) relates to a defective relay holder in the main fuse box in this case.

Repair note:

Check the main fuse box's date of manufacture.

Only affects the main fuse box (under the driver's seat) with the following date of manufacture: 11.25.2011.

- Replace the main fuse box.

OE no. 7P0 937 548F (not for hybrid)

OE no. 7P0 937 548G (for hybrid)

If the main fuse box has already been replaced in the course of a manufacturer campaign, this is indicated by a sticker in the area of the spare wheel well and documented in the service handbook.