

Toyota Auris - Nedsat funktion som følge af sædejustering | HELLA

**Toyota Auris Alle modeller med mekanisk aktivering af håndbremsen
Produktion: Storbritannien, Tyrkiet
Årgang: indtil 2007
Nedsat funktion som følge af sædejustering
Når førersædet i ovennævnte modeller køres frem til forreste anslag, kan det medføre en begrænsning i håndbremsegrebets funktion.
Årsag
Årsagen kan være for stor vandring hhv. forkert grundindstilling af håndbremsemekanismen.
Afhjælpning
Vi anbefaler følgende grundindstilling:
Håndbremsegrebets vandring skal indstilles således, at blokeringsgrænsen nås mellem 3 og 7 hakker.
I den forbindelse skal bilfabrikantens vedligeholdelses- og reparationsanvisninger altid følges!**

All models with mechanical handbrake operation

Production: Great Britain, Turkey

Year of construction: up until 2007

Function restriction caused by seat adjustment

If the driver's seat is moved to the forward-most position right up to the end stop on the above-mentioned vehicle model, this can lead to limited function of the handbrake lever.

Cause

One possible cause of this may be too long actuation travel or incorrect basic setting of the handbrake mechanism.

Remedy

We recommend the following basic setting:

the handbrake's lever travel should be set so that the locking limit is reached between 3-7 detents.

Please always observe here the relevant maintenance and repair instructions provided by the vehicle manufacturer!