



Hyundai Tucson - error codes P0320, P0321, P0322, P0323 and the engine won't start

Data sheet

Manufacturer	Hyundai
Vehicle model	Tucson
Engine	Petrol
Year of manufacture	2004 - 2010
Symptoms	Error codes P0320, P0321, P0322, P0323 Poor starting behaviour Engine stalls


Important safety note

Engine does not start / engine stalls

With the above-mentioned vehicles, it can happen that the engine starts sluggishly or not at all. There may also be ignition misfiring. The error codes P0320, P0321, P0322, P0323 (ignition) are often stored in the engine control unit. A sporadic signal interruption of the crankshaft sensor is a possible cause.

The following steps should be taken to rectify the problem:

- Remove the multiple connector from the crankshaft sensor and check the pins for contamination and/or corrosion
- If necessary, the pins must be cleaned or replaced.
- If the connector pins are in good working order, the cause could be a defect in the sensor
- After completion of the repair job, clear the error memory
- Carry out a test drive

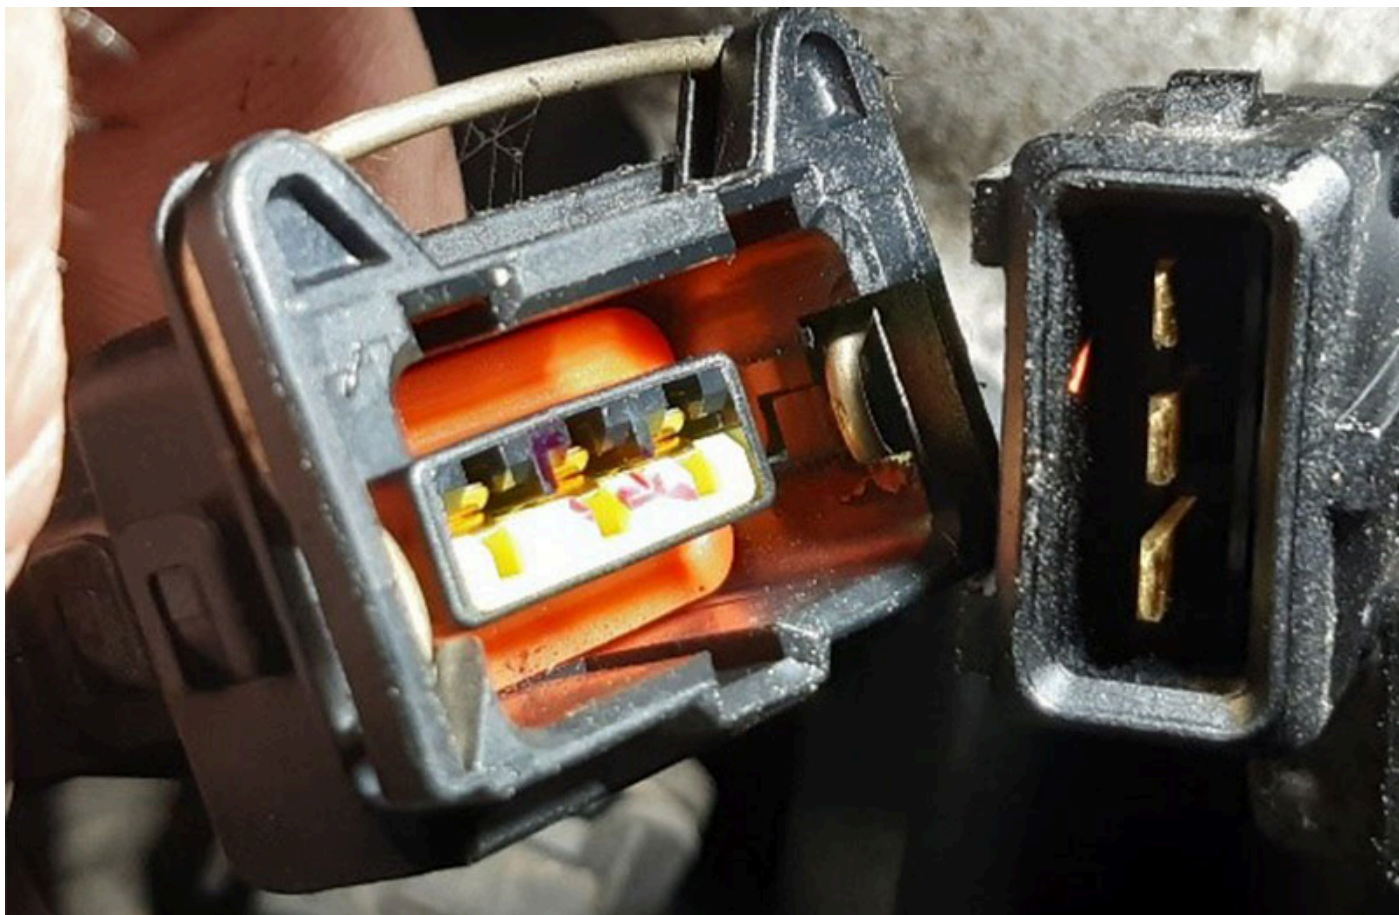

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.