



Kia Niro - noises coming from engine compartment

Data sheet	
Manufacturer	Kia
Vehicle model	Niro
Engine	All models with hybrid drive
Engine code	G 4 LE
Year of manufacture	2018 - 2019
Symptoms	Noises from the engine compartment
Error code	P2600

Important safety note

Noises from the engine compartment + error code P2600

If unusual noises are heard from the engine compartment of the above-mentioned vehicle, the cause could be a faulty electric coolant pump. Often the error code P2600 (coolant pump) is also stored in the control unit.

The cause of this could be internal corrosion brought about by water entering the pump motor. The following steps can be taken to remedy the situation:

- remove and disassemble the coolant pump
- If there are no traces of corrosion: repair pump with repair kit (251000-3HZ0FFF)
- If corrosion is visible, replace the pump

- Check the multi-connector of the coolant pump for corrosion and clean/repair where necessary
- Fill/vent cooling system and check for leaks
- Clear error memory
- Carry out a test drive

ⓘ ATTENTION - HIGH VOLTAGE

Please note that this kind of work may only be carried out by an authorised specialist workshop and by appropriately qualified personnel. The repair, maintenance and safety instructions of the vehicle manufacturer are to be strictly observed!





Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.