

Kia Rio - Accensione della spia motore | HELLA

Kia

Rio

Tutti i modelli, 2000 - 2004

Se su questi veicoli viene indicato un guasto tramite la spia motore e il cliente segnala anche un regime oscillante del motore, una possibile causa è un contatto incerto sul potenziometro della valvola a farfalla.

Per rimediare a questo inconveniente, per prima cosa si devono controllare visivamente e pulire i pin del connettore sul potenziometro della valvola a farfalla e nel connettore multipolare del fascio cavi.

Nota:

Controllare le tensioni sui morsetti del potenziometro della valvola a farfalla nel seguente modo:

- Potenziometro sul morsetto (massa) circa 0V.
- Potenziometro sull'alimentazione elettrica circa 5V
- Morsetto del potenziometro (segnale) una tensione variabile in base alla posizione della valvola a farfalla.



The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.