

Opel Astra-H, Zafira-B - ABS-controlelampje gaat branden | HELLA

Opel

Astra-H, Zafira-B

ABS-controlelampje gaat branden

Foutcode: C0045, C0050

Treden bij deze voertuigmodellen één of meerdere van de bovenstaande klachten op, kan waterindringing in de stekkerverbindingen van de wieltoerentalsensoren van de achteras hiervoor de oorzaak zijn. In dit geval moeten de stekkerverbindingen van de kabelsets van de ABS-sensoren bij de wielnaven worden gecontroleerd. Wordt bij de stekkerverbindingen waterindringing of zelfs al corrosie vastgesteld, moeten de betreffende stekker en sensor worden vervangen. Niet betroffen of nieuwe stekkerverbindingen moeten voor de montage worden ingevet met siliconenvet.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.