

Informação do produto — Calços de travão modificados | HELLA

Informação do produto Calços de travão modificados 8DB 355 009-121/8DB 355 011-731 Pinça de travão combinada TEVES Antigo: 8DB 355 009-121/T1215 Na versão 8DB 355 009-121/T1215, o calço do travão do lado do êmbolo foi fixada ao êmbolo por meio de junções (A) tipo “ratoeira”, de modo a evitar ruídos e vibrações. Isto exigia uma montagem cuidadosa por parte do técnico. Devido a erros de montagem ocasionais, não era possível engatar totalmente a junção no êmbolo, o que resultava num desgaste extremo e num aumento do ruído. Alguns fabricantes de veículos reviram este sistema e introduziram um calço do travão modificado. Novo: 8DB 355 011-731/T1489 O novo calço do travão difere significativamente da sua versão original, mas pode ser utilizado sem qualquer problema. Aviso: O calço do travão com mola de retenção (B) tem de ser montado na pinça de travão, do lado do êmbolo. Modelos de veículo afetados Opel/GM Signum, Vectra Ford Focus Nissan Primera Citroën C5 Mazda3, 5 Renault Espace, Laguna II, Vel Satis Saab 9-3 Aviso: Esta substituição de produto não foi efetuada em todos os modelos Renault e Nissan. Ter em atenção as atribuições de produtos correspondentes no catálogo. Figuras

8DB 355 009-121 / 8DB 355 011-731

Old: 8DB 355 009-121 / T1215

The brake pad on the piston side with version 8DB 355 009-121 / T1215, has been fixed to the piston using clasps (A) "Mouse traps" for the purpose of avoiding noise and vibration. The technician must practice great care when assembling.

Resulting from assembly faults, the clasps do not engage completely on the piston which leads to extreme tilted wear and increased noise levels.

Some vehicle manufacturers have reworked this system and have introduced a changed brake pad.

New: 8DB 355 011-731 / T1489

The equipment of the new brake pad differs significantly from its original version but can be used without question.

Note:

Brake pads with retaining spring (B) must be installed in the brake caliper on the piston side.

Vehicle models affected

Opel /GM

Signum, Vectra

Ford

Focus

Nissan

Primera

Citroen

C5

Mazda

3, 5

Renault

Espace, Laguna II, Vel Satis

Saab

9-3

Note:

This product replacement does not take place with all Renault and Nissan models. Please observe the respective product allocations in the catalog.

Figures

