

Mercedes W 204 — Ruídos na válvula de recirculação do ar | HELLA

MercedesW 204
Ano de fabrico: a partir de 2007
Ruídos na válvula de recirculação do ar
Nos veículos supracitados, podem surgir ruídos de rangido ou crepitantes na área da caixa do evaporador. As molas da válvula de recirculação do ar podem ser a causa. Para resolver o problema, deve proceder-se da seguinte forma:
Retirar a cobertura por baixo do painel de instrumentos
Desmontar o porta-luvas
Desmontar as molas antigas da válvula de recirculação do ar
Montar novas molas (A2048310079) e lubrificar os pontos de fixação
Realizar um teste de funcionamento
Montar o porta-luvas e a cobertura

W 204

Model year: from 2007 onwards

Noises in the circulating air flap

With the above-mentioned vehicle, crackling or clicking noises can occur around the evaporator unit. These noises can very well be caused by the springs on the circulating air flap.

The following steps should be taken to rectify the problem:

- Remove the cover below the dashboard
- Dismantle the glove compartment
- Remove the old springs from the circulating air flap
- Mount the new springs (A2048310079) and grease the fastening points
- Carry out performance check
- Reassemble glove compartment and replace cover