

Opel Astra-H, Zafira-B — Código de erro: C0045, C0050 | HELLA

Opel

Astra-H, Zafira-B

Todos os modelos a partir do Ano de fabrico 2005

A luz de controlo do ABS acende

Código de erro: C0045, C0050

Se, nos modelos de veículo supramencionados, ocorrer uma ou mais das falhas referidas, uma possível causa pode ser a infiltração de água nas conexões de ficha dos sensores de velocidade de rotação das rodas do eixo traseiro. Neste caso, devem ser verificadas as conexões de ficha das cablagens dos sensores de ABS nos cubos de roda. Caso seja detetada uma infiltração de água ou sinais de corrosão nas conexões de ficha, o conector e o sensor afetados devem ser substituídos. As conexões de ficha não afetadas ou novas devem ser lubrificadas com massa de silicone antes da montagem.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.