

Opel Astra J — Código de erro: P02E4 | HELLA

Opel Astra J Ano de fabrico: 2012 Motor: A17DTC (LUE) A17DTE (LKR) A17DTF (LKR) O motor não pega ou perda de potência durante a condução Código de erro: P02E4 Equivalente a: atuador da válvula do ar de admissão encravado na posição aberta, erro mecânico. Se o código de erro estiver associado ao problema acima, pode indicar a existência de humidade no sistema de admissão. Se o condensado do intercooler chegar à borboleta do acelerador, pode congelar e causar danos mecânicos. Para resolver o problema, deve proceder-se da seguinte forma: Desmontar e limpar o corpo da borboleta do acelerador Desmontar o intercooler Retirar a água do intercooler Limpar o intercooler e secar com ar comprimido Verificar as borboletas do acelerador e limpar Montar o intercooler Montar o corpo da borboleta do acelerador Se necessário, reprogramar

Astra J

Model year: 2012

Engine: A17DTC (LUE) A17DTE (LKR) A17DTF (LKR)

Engine does not start or loses power while driving

Error code: P02E4

This indicates the following: intake air-flap actuator jams when opened, a mechanical fault.

If the error code is linked with the above-mentioned problem, this can mean that moisture is present in the air-intake system.

If condensation finds its way from the charge air cooler into the throttle body, it can freeze there, an occurrence which can, in turn, lead to mechanical damage being done.

In order to remedy the situation, the following steps should be taken:

- Dismantle the throttle body housing and clean it
- Disassemble the charge air cooler
- Remove water from the charge air cooler

- Clean the charge air cooler and dry with compressed air
- Check throttle blades and clean
- Assemble charge air cooler
- Assemble throttle body housing and,

if necessary, reprogram