

Opel Insignia — Ajuste em altura do banco com defeito | HELLA

Opel Insignia Ano de fabrico: 2009 Ajuste em altura do banco com defeito Se, no veículo supramencionado, o ajuste em altura do banco do banco falhar, o fuso de ajuste pode estar bloqueado. O motor para o ajuste em altura pode bloquear entre o fuso e o batente de plástico. Uma anilha adicional (1) pode ser a solução. Procedimento: Desmontar o banco Desapertar o parafuso (2) e desmontar Utilizar uma anilha (1) com as dimensões 6,4 x 18 x 1,6 (n.º OE 11035613) Aplicar massa lubrificante especial (n.º OE 13329237) Posicionar o parafuso (2) e apertar com 10 Nm Montar o banco

Insignia

Model year: 2009

Height adjustment system for seating defective

If the height adjustment system for the seating in the vehicle mentioned above no longer functions, it can be the fault of a blocked adjustment spindle.

The motor responsible for the adjusting of the seat height can jam between the spindle and the plastic stopper.

The problem can be solved with the help of an additional washer (1).

Procedure:

- Dismantle seat
- Loosen screw (2) and dismount
- Place washer (1) with the measurements 6.4 x 18 x 1.6 in position (OE No. 11035613)
- Lubricate with special grease (OE No. 13329237)
- Replace screw (2) and tighten with 10 Nm torque
- Remount seat



