

Opel Meriva B — Código de erro P00B7 | HELLA

OpelMeriva B
Ano de modelo: 2011–2012
Motor: A14XEL / A14XER
Código de erro P00B7
Nos veículos supramencionados, a luz de aviso da temperatura do líquido de refrigeração pode piscar de forma repentina. O código P00B7 (fluxo insuficiente do líquido de refrigeração) está registado na memória de erros. A causa pode ser um débito insuficiente da bomba do líquido de refrigeração (em determinadas situações de operação). Para resolver o problema, deve ser instalada uma bomba do líquido de refrigeração modificada (55579016). Os veículos a partir do ano de modelo 2013 já possuem uma bomba do líquido de refrigeração modificada.

Meriva B

Model year: 2011–2012

Engine: A14XEL / A14XER

Error code P00B7

The coolant temperature warning light may suddenly flash on the vehicles listed above. Code P00B7 (engine coolant flow insufficient) is stored in the error memory.

The cause may be an insufficient delivery rate of the coolant pump (in certain operating situations).

To remedy the fault, a modified coolant pump (55579016) should be installed.

Vehicles from model year 2013 already have a modified coolant pump.