

Opel Vivaro — A luz de controlo do motor acende | HELLA

Opel Vivaro Ano de fabrico: 2011–2013 VIN: BV600001–DV602062 Código do motor: M9R-630 A luz de controlo do motor acende. No veículo supramencionado, a luz de controlo do motor acende durante a condução em descidas por um período prolongado. Além disso, os códigos de erro P0201, P0202, P0203 e P0204 (equivalente a: Válvula de injeção/Bico 1–4, falha de funcionamento do circuito elétrico) são armazenados no módulo de comando do motor. Neste caso, a causa pode ser uma calibração incorreta do módulo de comando do motor. O fabricante do veículo já identificou este problema. Uma atualização do software estará disponível a partir da semana 5/2013. A partir de 2012.11.26 e do VIN WOLF7B1AEDV602062, é utilizado um software modificado na produção.

Vivaro

Model year: 2011–2013

Chassis no.: BV600001 – DV602062

Engine code: M9R-630

The engine warning light illuminates.

On the vehicle specified above, a complaint has been made that the engine warning light illuminates when traveling downhill over longer distances.

In addition, error codes P0201, P0202, P0203 and P0204 (synonymous with: injection valve / nozzle 1-4, power circuit malfunction) are stored in the engine control unit.

The cause could be a faulty calibration of the engine control unit.

The vehicle manufacturer has already addressed the issue.

A software update is available from CW 5 / 2013.

A changed software shall be used in the production from November 26, 2012 and chassis number WOLF7B1AEDV602062.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.