

# **Mini BMW Mini Cooper - Instrument panel with sporadic malfunctioning | HELLA**

**Mini**

**BMW Mini Cooper**

**Model year:**

**11/2003 - 01/2004**

**Engine code: W10 B16A**

**All models without navigation system**

**Instrument panel with sporadic malfunctioning.**

If a complaint is made regarding the above-mentioned fault in one of these vehicles, the possible cause is bad contact on the 12-pin multiple connector of the instrument panel.

Fault analysis is to be carried out by visibly checking the 12-pin multiple connector of the instrument panel. If the multiple connector has a transparent cover, it is to be replaced by the modified model provided by the manufacturer.

In addition, the electrical contacts / leads in the area of the instrument panel are to be visibly checked to ensure proper plugging in and correct cable laying.

Connector cover:

Spare part no.: 61.13.8.365.906